

USAARL Report No. 95-10

**S**DTIC  
ELECTE  
MAY 1 1 1995  
**C** **D**



①

## OH-58 Pilot Display Unit (PDU) Simulated Crash Tests

By

Joseph L. Haley, Jr.  
Cobro Corporation

and

B. Joseph McEntire  
Aircrew Protection Division

December 1994

19950509 113

Approved for public release; distribution unlimited.

United States Army Aeromedical Research Laboratory  
Fort Rucker, Alabama 36362-0577

Notice

Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.


Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.

Disclaimer


The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

Reviewed:




KEVIN T. MASON  
LTC, MC, MFS  
Director, Aircrew Protection Division

Released for publication:



DENNIS F. SHANAHAN  
Colonel, MC, MFS  
Commanding

  
ROGER W. WILEY, D. D., Ph.D.  
Chairman, Scientific  
Review Committee

**REPORT DOCUMENTATION PAGE**

1a. REPORT SECURITY CLASSIFICATION Unclassified		1b. RESTRICTIVE MARKINGS	
2a. SECURITY CLASSIFICATION AUTHORITY		3. DISTRIBUTION/AVAILABILITY OF REPORT Approved for public release, distribution unlimited	
2b. DECLASSIFICATION/DOWNGRADING SCHEDULE		4. PERFORMING ORGANIZATION REPORT NUMBER(S) USAARL Report No. 95-10	
4. PERFORMING ORGANIZATION REPORT NUMBER(S) USAARL Report No. 95-10		5. MONITORING ORGANIZATION REPORT NUMBER(S)	
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory	6b. OFFICE SYMBOL (if applicable) SGRD-UAD-IE	7a. NAME OF MONITORING ORGANIZATION U.S. Army Medical Research and Materiel Command	
6c. ADDRESS (City, State, and ZIP Code) P.O. Box 620577 Fort Rucker, AL 36362-0577		7b. ADDRESS (City, State, and ZIP Code) Fort Detrick Frederick, MD 21702-5012	
8a. NAME OF FUNDING/SPONSORING ORGANIZATION	8b. OFFICE SYMBOL (if applicable)	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER	
8c. ADDRESS (City, State, and ZIP Code)		10. SOURCE OF FUNDING NUMBERS	
		PROGRAM ELEMENT NO. 62787A	PROJECT NO. 30162787A878
		TASK NO. EA	WORK UNIT ACCESSION NO. 138
11. TITLE (Include Security Classification) OH-58 pilot display unit (PDU) simulated crash tests			
12. PERSONAL AUTHOR(S) J. L. Haley, Jr., and B. Joseph McEntire			
13a. TYPE OF REPORT Final	13b. TIME COVERED FROM _____ TO _____	14. DATE OF REPORT (Year, Month, Day) 1994 December	15. PAGE COUNT 43
16. SUPPLEMENTARY NOTATION			
17. COSATI CODES		18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)	
FIELD	GROUP	OH-58, pilot display unit, crash test, head injury, crash injuries	
25	03		
06	14		
19. ABSTRACT (Continue on reverse if necessary and identify by block number)			
<p>The pilot display unit (PDU) is designed to be placed directly in front of the pilot's eyes in the OH-58 helicopter to provide targeting and a missile status display. The location and the 7-pound mass of the unit creates a potentially hazardous head impact surface. In order to determine the degree of the hazard, a damaged OH-58 cockpit section was exposed to five survivable simulated crashes of moderate to severe impact vectors with an instrumented dummy pilot in the right seat behind the PDU. The cockpit floor was exposed to crash force up to 8 G in the vertical (z) axis and 19 G along the longitudinal (x) axis with velocity changes of 24 fps and 36 fps, respectively. These exposures did not exceed acceptable levels of human tolerance for neck and head forces when a properly fitted flight helmet was worn so that impact occurred on the helmet and not the head.</p>			
20. DISTRIBUTION/AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT. <input type="checkbox"/> DTIC USERS		21. ABSTRACT SECURITY CLASSIFICATION Unclassified	
22a. NAME OF RESPONSIBLE INDIVIDUAL Chief, Science Support Center		22b. TELEPHONE (Include Area Code) (205) 255-6907	22c. OFFICE SYMBOL SGRD-UAX-SI

Contents

	Page
List of tables . . . . .	1
List of figures . . . . .	2
Introduction . . . . .	5
PDU description . . . . .	5
Test objective . . . . .	6
Materials and test methods . . . . .	6
Test results . . . . .	10
Conclusions . . . . .	15
References . . . . .	17
Appendix A. Pilot display unit transducer results . . . . .	37
Appendix B. Manufacturer's list . . . . .	43

List of tables

Table	Page
1. OH-58 PDU test conditions . . . . .	8
2. Test instrumentation for the PDU . . . . .	9
3. Summary of PDU test results . . . . .	11

Accession For	
NTIS CRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification _____	
By _____	
Distribution / _____	
Availability Codes	
Dist	Avail and/or Special
A-1	

List of figures

Figure		Page
1.	Left side view of PDU installation, breakaway position shown . . . . .	18
2.	Front view of PDU installation, normal in-use position shown . . . . .	19
3.	Profile sketch of PDU location in OH-58 cockpit showing the normal and crash breakaway position . . .	19
4.	Pretest view of no. 88060; note the absence of crash-worthy seat cushion and the dummy PDU and mount . . .	20
5.	Posttest view of no. 88060; note the rearward rotation of helmet after rebound . . . . .	20
6.	Posttest view of 50th percentile dummy; note helmet rotated until stopped by nape strap . . . . .	21
7.	Posttest view of 95th percentile dummy in left seat . . . . .	21
8.	Seat pan downward displacement of 0.3 inch shown between latch and bulkhead support, right side . . .	22
9.	Seat pan downward displacement of 0.6 inch shown between latch and bulkhead support, left side . . .	22
10.	Pretest view of CAMI 88061; note aluminum strap on inside of left door frame and steel strap on right seat . . . . .	23
11.	Posttest view of CAMI 88061; note that helmet has not rotated due to tape under chin . . . . .	23
12.	Pretest of no. 88062; note potentiometer cable attached to back of helmet . . . . .	24
13.	Pretest view of no. 88062; note board placed at back of seat to place right dummy 1.5-inch forward . . .	24
14.	Posttest view of no. 88062; note rebound position of sled about 1 foot from displaced ¼-inch diameter cables . . . . .	25
15.	Posttest view of no. 88062; note missing clay which was found on helmet of right dummy . . . . .	25
16.	Posttest of no. 88062; note buckled "box" section of fuselage station 73.04 bulkhead . . . . .	26

List of figures (Continued)

17.	Posttest view of no. 88062; note buckled skin adjacent to "box" section of fuselage station 73.04 bulkhead . . . . .	26
18.	Posttest view of fuselage station 73.04 bulkhead; note buckles in control closet structure by arrows . . . . .	27
19.	Pretest view of no. 88063; note 15-degree right yaw orientation, and prior damage to nose structure . . . . .	28
20.	Posttest view of no. 88063; note the actual production PDU mount in place and bulkhead 73.04 reinforcement . . . . .	28
21.	Pretest view of no. 88064; note diagonal aluminum strap added to prevent forward movement of upper door post . . . . .	29
22.	Pretest view of no. 88064; note board behind back cushion to move dummy forward 1.5 inch . . . . .	29
23.	Posttest view of no. 88064; note limp, stretched aluminum diagonal strap, and PDU mount detachment . . . . .	30
24.	Posttest view of no. 88064; note detached PDU "breakaway" mount and cracked foam at back edge of PDU . . . . .	30
25.	Posttest view of no. 88064; arrow denotes cracked helmet visor cover . . . . .	31
26.	Posttest view of no. 88064; arrow denotes failed rivets which help to secure the breakaway mount . . . . .	31
27.	Helmeted head displacement in 30-degree pitch down test 88060 . . . . .	32
28.	Helmeted head displacement in second 30-degree pitch down test 88061 . . . . .	33
29.	Helmeted head displacement in horizontal (x-axis) test 88062 . . . . .	34
30.	Helmeted head displacement in x-axis, 15-degree yaw, test 88063 . . . . .	35
31.	Helmeted head displacement in horizontal (x-axis) with 15-degree right yaw, test 88064 . . . . .	36

List of figures (Continued)

Figure	Page
A-1. Sled and right seat dummy head deceleration traces from five PDU tests . . . . .	38
A-2. Right dummy helmet displacement and neck moment about the y-axis for five PDU tests . . . . .	39
A-3. Right dummy neck force and chest deceleration for all five PDU tests . . . . .	40
A-4. Lumbar force and moment traces for all PDU tests . . . . .	41
A-5. Comparison of left dummy helmet displacement in test 88060: rotary potentiometer vs. film analysis . . . . .	42

## Introduction

The pilot display unit (PDU) is designed to be placed on the right (pilot's) side of the OH-58 helicopter to provide visual targeting and a missile status display. The location of the PDU (directly in front of the pilot's face) and the 7-pound mass of the unit potentially creates a hazardous head impact surface in some accident scenarios. Computer model studies by Bell Helicopter Textron (BHT) showed the potential existed for head injury in accidents as discussed at an in-process review (IPR) of the PDU at BHT. Contact of the pilot's helmet to the PDU also was noted by the U.S. Army Aviation Developmental Test Activity (ADTA) in 1987 as shown in their documentation photograph (Figure 1).

Subsequent to the 1987 IPR, the PDU program manager (PM) contracted with BHT to design and "drop test" a new breakaway mechanism to permit the 7-pound PDU to "break free" during a crash and move forward 3.5 inches along a track. In early 1988, the PDU PM and the U.S. Army Aeromedical Research Laboratory (USAARL) mutually agreed a suitable "crash" could be simulated with the surplus OH-58 fuselage which Aviation Systems Command (AVSCOM) had procured for use in crash testing the OH-58 retrofit pilot's seat (Haley and Palmer, in press). The testing scheme used the damaged front cockpit salvaged from an OH-58 mishap. Arrangements were made with the Federal Aviation Administration's (FAA) Civil Aeromedical Institute (CAMI) to conduct and document the crash tests.

Initial plans, stated by the PDU PM, called for BHT to supply a suitable dummy PDU test item and an OH-58 cockpit test fixture, and to monitor the crash tests. USAARL agreed to direct the crash tests, analyze the data, and provide a test evaluation report. This report fulfills the agreement.

## PDU description

The unit as installed in the OH-58 helicopter is shown in Figures 1 and 2. The PDU is designed to break free at a deceleration of 2 G from the normal (flight) position, move forward and downward to the end of the slotted track, as shown in Figure 3. The prototype PDU was "drop" tested at the BHT facility in 1987 and the unit slid forward properly at 2 G deceleration (Powell, 1988). The PDU mount is detailed in BHT drawing 206-071-280-105.



## Test objective

To determine the effects of the OH-58 dummy pilot impacting against the new PDU during simulated crash conditions.

## Materials and test methods

The surplus damaged OH-58 fuselage is shown installed on the CAMI impact sled and track in Figure 4. The sled is mounted on rollers and is accelerated along two tracks by a cable passing through several rollers and attached to an elevated mass. The decelerative "crash" is provided by sled contact with ¼-inch diameter steel wires which are pulled around rollers anchored in the floor. The decelerative pulse shape is varied by the total number of wires and their placement along the track.

The OH-58 honeycomb belly "bathtub" was cleanly severed just forward of the troop seat and the roof was cut through just forward of the transmission mount (Figure 5). The pilot seat bulkhead with shoulder strap guides and the upright center "box" beam were left intact. The forward fuselage then was rigidly mounted to a horizontal "crash" sled with a belly-mount structure which could be oriented to provide the desired crash force vector. The intent was to conduct six to eight crash tests up to a 28 G level without causing irreparable damage to the forward fuselage. Thus, instrumented "dummy" pilots could be installed in the sled-mounted fuselage, and crash vectors applied to the sled so both the crashworthy seats and the PDU head injury potential could be evaluated with the same fuselage in a single test series.

BHT prepared a dummy PDU test specimen and mount for the OH-58 test cockpit as shown in Figure 4. The dummy PDU was located the same as the actual device would be after "breakaway," i.e., 3.5 inches forward down the 29-degree slope ramp as shown in Figure 3. The dummy PDU was constructed to simulate the actual PDU adjusted 1 inch down from the "full-up" adjustment; thus the test was conservative because the eye height of the 50th percentile dummy actually was 0.27 inch higher than would be normal in most standard plastic mesh seats with the buttock reference point (BRP) at waterline (WL) 32.73 in lieu of WL 33.0 on the test crashworthy seat. The extra 0.27 inch represents a 59th percentile eye height for an upright pilot (Donelson and Gordon, 1991). However, the usual slumped flying posture indicates this would be an 83rd percentile pilot in slumped posture (slump subtracts approximately 0.9 inch). In any event, the test was conservative because a large percentile dummy eye height was used with the PDU adjusted down 1 inch for a small pilot so that a PDU strike was more likely to occur.

The test conditions for the five sled runs conducted to evaluate the PDU's crash performance are shown in Table 1. The first test (CAMI 88060) was selected to simulate a SOM-LA modeling analysis (Laananen, Coltman, and Bolukbasi, 1982) done by BHT. The second test (88061) repeated the first except the velocity of impact was increased along with the onset rate. The third test simulated a pure longitudinal (x-axis) impact. The fourth and fifth tests (88063 and 88064) were similar to the third test except 15 degrees right yaw was added and the velocity change was increased. These "crash" simulations were selected after conferences with the U.S. Army Safety Center (USASC) and AVSCOM. The consensus was the impact energy and stopping force (peak G) used in these tests were near the limits of a survivable crash for the OH-58 structure.

The 50th percentile Hybrid III dummy occupied the right seat for all five PDU tests, and the 95th percentile VIP dummy occupied the left seat for the first three tests only. The large VIP dummy primarily was used for testing convenience, to prevent recalibrating the ¼-inch diameter steel rods used to stop the sled during the prior crashworthy seat tests. The large dummy also was used to provide comparative test data between the 50th and 95th percentile dummies and to note whether the dual-mode (1.5 G lock) reel (used in the left seat) was reliable and effective. The test instrumentation is listed in Table 2.

The inertia reels of both "dummy" pilots were set to the unlocked condition to ensure conservatism. The unlocked reels would permit more strap movement before stopping the torso.

#### Film motion analysis

Film footage of PDU tests was analyzed on a NAC™ model PH-160F\* film motion analyzer. The lower left corner of the image was considered to be the origin (x=0, y=0). A background strobe light signaled the beginning of each impact sequence. The frame in which the light came on was considered to be the first frame for each impact sequence. A scaling factor was calculated for each impact sequence by obtaining coordinates for the top and bottom of the fuselage (rear most area) and the absolute distance between these two standard points was determined. The actual distance from the top to the bottom of the fuselage then was divided by the absolute distance to give the scaling factor. Since the camera was located approximately 50 feet from the sled, no correction was made for the minimal parallax involved.

---

\* See manufacturer's list

Table 1.  
OH-58 PDU test conditions.

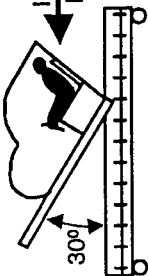
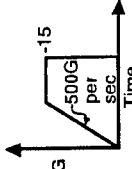
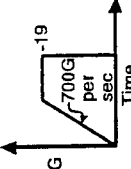

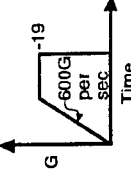
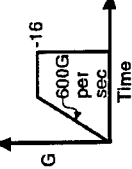
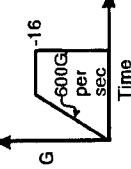
Test identity	Sled velocity (fps)	Cockpit orientation on test sled	Applied pulse (G - sec)	Hybrid III Dummy description (50th% size) -right seat-	Remarks
CAMI 88060 pitch down zero yaw zero roll	23.5			Hybrid III with neck & Lumbar load cells + Triax accelerometers in head & chest-flight suit, med. size helmet & leather boots	* Replicates Somalia analysis
CAMI 88061 same as 060	28.3	(same as 060)		(same as above)	
CAMI 88062 forward (X-axis) only	30.4			(same as above)	Rt. dum. moved fwd. 1.5" to ensure PDU impact
CAMI 88063 forward with 15° rt yaw	35.5	(same as 062 + 15° yaw to right)		(same as above)	Actual PDU "breakaway" track installed
CAMI 88064 same as 063	35.8	(same as 063)		(same as above)	- Actual PDU "breakaway" track installed - Rt. dummy moved fwd. 1.5" and Rt. by 1.5" to insure PDU impact

Table 2.

Instrumentation for PDU testing.

---

- Sled X (resultant acceleration (G)  
(two each used for reliability)
- 50th percentile (Hybrid III) dummy transducers
  - Head x, y, z accelerometers and xyz resultant calculation
  - Chest x and z accelerometers
  - Spinal column load cells in right seat dummy
    - Neck x, y, and z force, and moment about x, y, and z axes
    - Lumbar x, y, and z force, and moment about x, y, and z axes
- Right helmet movement (Celesco rotary potentiometer\*)  
(5 G extraction limit caused gross error)
- Right side profile camera at approximately 50 feet distance  
(1000 frames/sec)
- Right side profile camera at approximately 35 feet distance  
(500 frames/sec)
- Left side profile camera at approximately 35 feet distance  
(500 frames/sec)

Notes:

(1) Ektachrome reversal, type 7250, EP400 film\*

(2) The filtering used for all transducers met the requirements of Society of Automotive Engineers J211 report, "Instrumentation for impact test." Pertinent requirements are listed:

<u>Instrument</u>	<u>Frequency response channel/class</u>
CAMI sled accelerometers, lumbar and neck load cells, and rotary potentiometers	60
Chest and pelvis accelerometers	180
Head accelerometers	1000

---

Coordinates were obtained for the helmet reference point directly over the dummy's ear, the PDU, targets on door frame, and in some cases, for the point where the restraint harness was attached to the seat back. Data were entered into a database which later was used with a graphics program. Graphs depicting the displacement of the helmet reference points were generated for each sequence. Helmet reference point velocity was calculated using the distance between each point divided by the time increment (the time was based on film speed).

Helmet rotation was determined by tracing the outline of the helmet at various times during the impact sequence and measuring the angle of the helmet brow line in relation to the bottom of the fuselage. Helmet rotation then was plotted on the helmeted head displacement curves.

### Test results

The PDU tests were conducted at the FAA CAMI test center, Oklahoma City, Oklahoma, 22-24 June 1988. The tests were done subsequent to the three OH-58 crashworthy seat tests (88057, 88058, and 88059) which were completed 17 June 1988. The OH-58 cockpit structure and broken crashworthy seats were mended and strengthened sufficiently to keep the cockpit structure intact and to simulate the stiffness of the PDU mount area during a crash.

The test results are summarized in Table 3. The more important transducer traces between the five tests are copied and compared in the Appendix, Figures A-1 through A-4. Traces not present in this report would not have provided significant data, and were deleted to save the cost of preparation and printing. Data not presented is available from USAARL's archives, if desired.

Table 3 includes PDU mount type, PDU displacement, helmet impact, and dummy neck/moment data. The head acceleration values are not presented because all the values are less than 60 G and not significant. The neck force and neck moment about the lateral (y) axis are significant and are shown in Table 3; the traces are shown in figures A-1 through A-4. The neck forces and moments do not exceed the tolerance limits noted by Alem and Haley (1988).

The movement of the right pilot's helmeted head was determined by film analysis and is shown to one-quarter scale for all five runs in Figures 27 through 31.

Table 3.  
Summary of PDU test results\*.

Test identity	Sled velocity (fps)	Sled peak deceleration (G)	Actual PDU breakaway mount used?	PDU mount actuation?	Helmet to PDU contact (impact)	Dummy neck resultant force (lb)	Dummy neck movement about Y-axis (in-lb)
CAMI 88060 pitch down zero yaw zero roll	23.5	15	no	not applicable	yes very light	444	613
CAMI 88061 same as 060	28.3	19	no	not applicable	yes light	579	1195
CAMI 88062 forward (X-axis) only	30.4	19	no	not applicable	yes moderate	424	679
CAMI 88063 forward with 15° rt yaw	35.5	16	yes	yes	no	691	1150
CAMI 88064 same as 063	35.8	16	yes	yes	yes moderate**	488	803

\*Head accel, neck force/mom. pelvic force/mom. & chest accel are located at A-1 to A-4.

\*\*PDU mount at windshield frame failed partially during rebound, see Fig 24.

## Test 88060

The setup for test 88060 is shown in Figure 4. As shown in Table 1, this test simulates a pitch down crash in which the vertical force is slightly greater than half the forward force. At 500 G/sec acceleration onset and 15-G peak combined with only 23.5 fps velocity, the impact was of moderate level. As shown in Table 3, the neck tensile force of 444 pounds and 613 inch-pound moment about the lateral (y) axis is about half that of the values in test 88063. The force transfer into the PDU ½-inch ENSOLITE™\* foam from the helmet impact did not register on the neck load cell or the head accelerometers.

The movement of the helmeted head of the left dummy was recorded by a Celesco potentiometer as shown in figure A-5. the recorded 26-inch value obviously was incorrect based on a cursory film review; the film analysis revealed a movement of 13 inches, half that shown by the potentiometer. Note in Figure A-5 the film showed about 1½-inches of movement before the potentiometer began to rotate (record), and the potentiometer continued to record movement from 15 to 26 inches between 150 and 200 ms. Thus, it is clear the potentiometers on both dummies cannot be used for precise movement data. Discussions with the CAMI test track chief, Mr. Gowdy, indicate the acceleration of the cables from the instruments exceeded the rate limitations of the device. Nonetheless, the first four recordings from the right dummy's helmet are copied and compared in Figure A-2, and all show a similar "overrun" error from 21 to 29 inches. The actual helmeted head movement in all five tests shows movement of 12 to 14 inches. Thus, the film analysis motion is used exclusively in discussing helmet movement in these tests.

Posttest photos of test 88060 in Figures 4 through 9 show: (a) rotation of helmet rearward on right dummy, but not the left dummy, even though both have equal size 50th percentile heads; the difference may be due to the lack of neck flesh on the Hybrid II (50th percentile) dummy; and (b) the left seat crashworthy seat pan sustained enough downward force from the dummy's buttocks to move the pan down 0.6 inch, and to move the right seat down by 0.3 inch. This was a surprise since the impact vector was 15 G forward, and the seat pans stroke at 12 G vertical. The right seat pan was secured with steel straps to prevent movement in subsequent tests.

## Test 88061

The setup is shown in Figure 10, the straps to secure the right seat are shown along with the reinforcement of the left forward door bulkhead. The posttest photo is at Figure 11.

Review of the helmet's movement in Figure 28 shows almost identical movement to the prior test (approximately 13.8 inches in this test, and 13.7 inches in 88060). One would have expected more movement with greater energy and peak G in the sled pulse. It may be the inertia reel locked sooner in the pulse sequence and prevented as much shoulder strap extension. For some unknown reason, the dummy's helmeted head moved downward nearly 6 inches in lieu of 2.1 inches in the identical test 88060; this downward movement caused the helmet to almost miss the PDU with only grazing contact. No marks could be seen on the helmet visor cover and no contact is shown by film analysis in Figure 28.

Reference to Table 3 shows the neck moment to be twice as much as in the test 88060; thus neck moment correlates with the head movement. Probably the greater energy of the vertical force component caused the head-helmet mass to bend the neck much further downward and forward than in the prior test.

The left seat pan stroked down to 3 inches at the pan's rear, but no action was taken to prevent stroke to the left seat.

#### Test 88062

In this pure longitudinal x-axis test, the likelihood for PDU impact is greatest. The right dummy was placed 1.5 inches forward in the seat by use of a wooden spacer between the dummy and the seat cushion as shown in pretest Figures 12 and 13. Damage to the aircraft structure is documented in Figures 14 through 18.

In spite of greater energy in this test over 88061, the right dummy's neck force and moment were little greater than the first test (88060), as shown in Table 3; the apparent anomaly is explained partially by the lack of a vertical impact vector in this test. However, reference to Figure 29 shows contact between the helmet and PDU at about 135 ms. Simultaneously, the movement in the neck about its lateral (y) axis also changes slope and becomes a constant level at just over 600 inch-pounds for the next 40 ms as seen in Figure A-2. In this time span between 135 and 175 ms, interpretation of Figure 29 shows the helmet's energy being reduced by: (1) foam compression, (2) inertial force against the PDU, (3) structural deformation of the PDU mount, and (4) sliding friction caused by 3 to 4 inches relative movement. Thus, it is highly probable the neck moment would have been much greater, perhaps twice as great if the helmet-PDU impact did not occur.

This test is a moderate level impact even though the film shows the PDU moving about 2 inches up and 2 inches forward on



the elastic PDU mount. the "moderate" impact description pertains to the insignificant change in the acceleration of the head as shown in Figure A-1; note the head deceleration peaked at 105 ms and reduced to approximately 10 G, and did not sustain a greater value for the remainder of the pulse. Thus, the absence of significant head deceleration and neck moment provides a noninjurious "safe passage" for the dummy pilot through this crash scenario.

The helmet was replaced after this test due to permanent foam compressive "set" of about 0.05 inch over an area of about 1 square inch in the lower front edge of the foam liner. The foam replacement is required to obtain the full energy-absorbing benefit of the foam liner if impacted again at the same location. The impact location onto the PDU is shown in Figure 15.

The fuselage station (FS) 73.04 bulkhead was damaged by skin crippling/buckling at the lower outboard edges and at the control "closet" box structure as shown in Figures 16-18. The bulkhead was reinforced prior to the final tests.

#### Test 88063

To fully explore the potential crash vector envelope, the forward vector was changed to include a 15-degree right yaw and the impact energy (velocity) was increased to 35.5 fps. In addition to the impact vector change, the actual PDU "breakaway" mount with track was used with the PDU in the normal "IN-USE" position. The IN-USE position is 3.5 inches rearward and about 1.5 inches upward from the breakaway (crash position. The actual PDU mount may be seen in pre- and posttest Figures 19 and 20 which also show the cockpit reinforcement and the 50th percentile dummy with hands on the cyclic control. Note in Figure 20 that the PDU moved forward and down during impact to the breakaway location.

The right dummy pilot was moved 1.5 inches forward by placement of a wooden block in the seat back as in test 88062. Also, the 95th percentile dummy was removed from the left seat in order to lessen the restraint harness loads acting on the FS 73.04 bulkhead for the final tests.

The test was successful in that the PDU moved forward and downward along the twin track, as designed, prior to the helmeted head entering the space; thus, no PDU-helmet impact occurred. The helmeted-head movement from film analysis is at Figure 30; a slight correction due to the 15-degree yaw was needed. The camera was located at right angles to the sled path, but skewed 15 degrees to the cockpit's motion so the distance moved by the

helmet was 3 percent greater than recorded from the film (the maximum correction was:  $12.5 \text{ inches} \div \text{COS } 15 \text{ degrees} = 12.9 \text{ inches}$ ).

The transducer data are shown in Figures A-1 through A-4. The head deceleration peaked at 48 G, the highest of all five runs, but well within human tolerance. The moment load on the upper neck peaked at 1150 inch-pound (see Table 3) and Figure A-2), but less than the 1195 foot-pounds seen in test 88061. Again, this value is within human tolerance as noted in Alem and Haley (1988).

#### Test 88064

This test was a repeat of test 88063 except the dummy was moved forward 1.5 inch by placing a wooden block behind it and to the right by 1.5 inch by simply sliding the dummy to the right, flush against the lap belt inner surface (Figure 21). In addition, an 0.05 x 1.5-inch aluminum strap was added to the right door opening as shown in the same figure. This strap was intended to reduce elastic deflection of the upper door post.

Helmet to PDU impact occurred; Figure 31 shows the impact from film analysis. The impact appeared to be severe based on film review since the PDU mount failed at its leading edge rivet attachment to the windshield overhead frame, as depicted in Figures 23, 24, and 26. The impact cracked the helmet visor cover at its center low edge, as shown in Figure 25. The PDU foam also was cracked and the visor cover released the visor knob and visor.

In spite of the damage to the mount and a fracture of the helmet visor cover, the neck force and moment values are less than those recorded in test 88061. Again, the neck transducers show a change in slope of the force and moment curves at approximately 105 ms, the time of the initial helmet impact, and the peak values were less than the prior test where the helmet did not impact the PDU. It is evident that helmet impact against the PDU tends to lower the force and moment in the neck caused by inertial force. Since the helmet prevents excessive head deceleration (from PDU impact), the PDU is not considered a hazard for helmeted pilots.

#### Conclusions

The PDU device breaks free and slides forward out of the path of a flailing head for most crashes. For those crashes in which helmeted-head impact occurs, peak deceleration of the head

is not excessive, and neck forces and moments are within tolerable limits.

Under the simulated crash conditions, the PDU unit tested does not cause injuries to helmeted pilots. This statement assumes the use of a properly-fitted SPH-4 helmet.

## References

- Alem, Nabih M., and Haley, J. L., Jr. 1988. Assessment of human tolerance based on Hybrid III transducer readings. Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. USAARL White paper for use by TACOM.
- Donelson, Sarah M., and Gordon, Claire C. 1991. 1988 anthropometric survey of U.S. Army personnel: Pilot summary statistics. Natick, MA: U.S. Army Natick Research, Development and Engineering Center. NATICK TR-91/040.
- Haley, J. L., Jr., and Palmer, Ronald W. 1994. Evaluation of a retrofit OH-58 pilot's seat to prevent back injury. Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. In press.
- Laananen, D. H., Coltman, J. W., and Bolukbasi, A. O. 1982. Computer simulation of an aircraft seat and occupant in a crash environment, volume II, Program SOM-LA user manual. Atlantic City Airport, NJ: F.A.A. Technical Center. DOT/FAA/CT-82/33-i.
- Powell, David. 1988. Air-to-air stinger pilot's display unit mount assembly, drop test, test results. Fort Worth, TX: Bell Helicopter Textron. Bell Report No. 206-091-062.


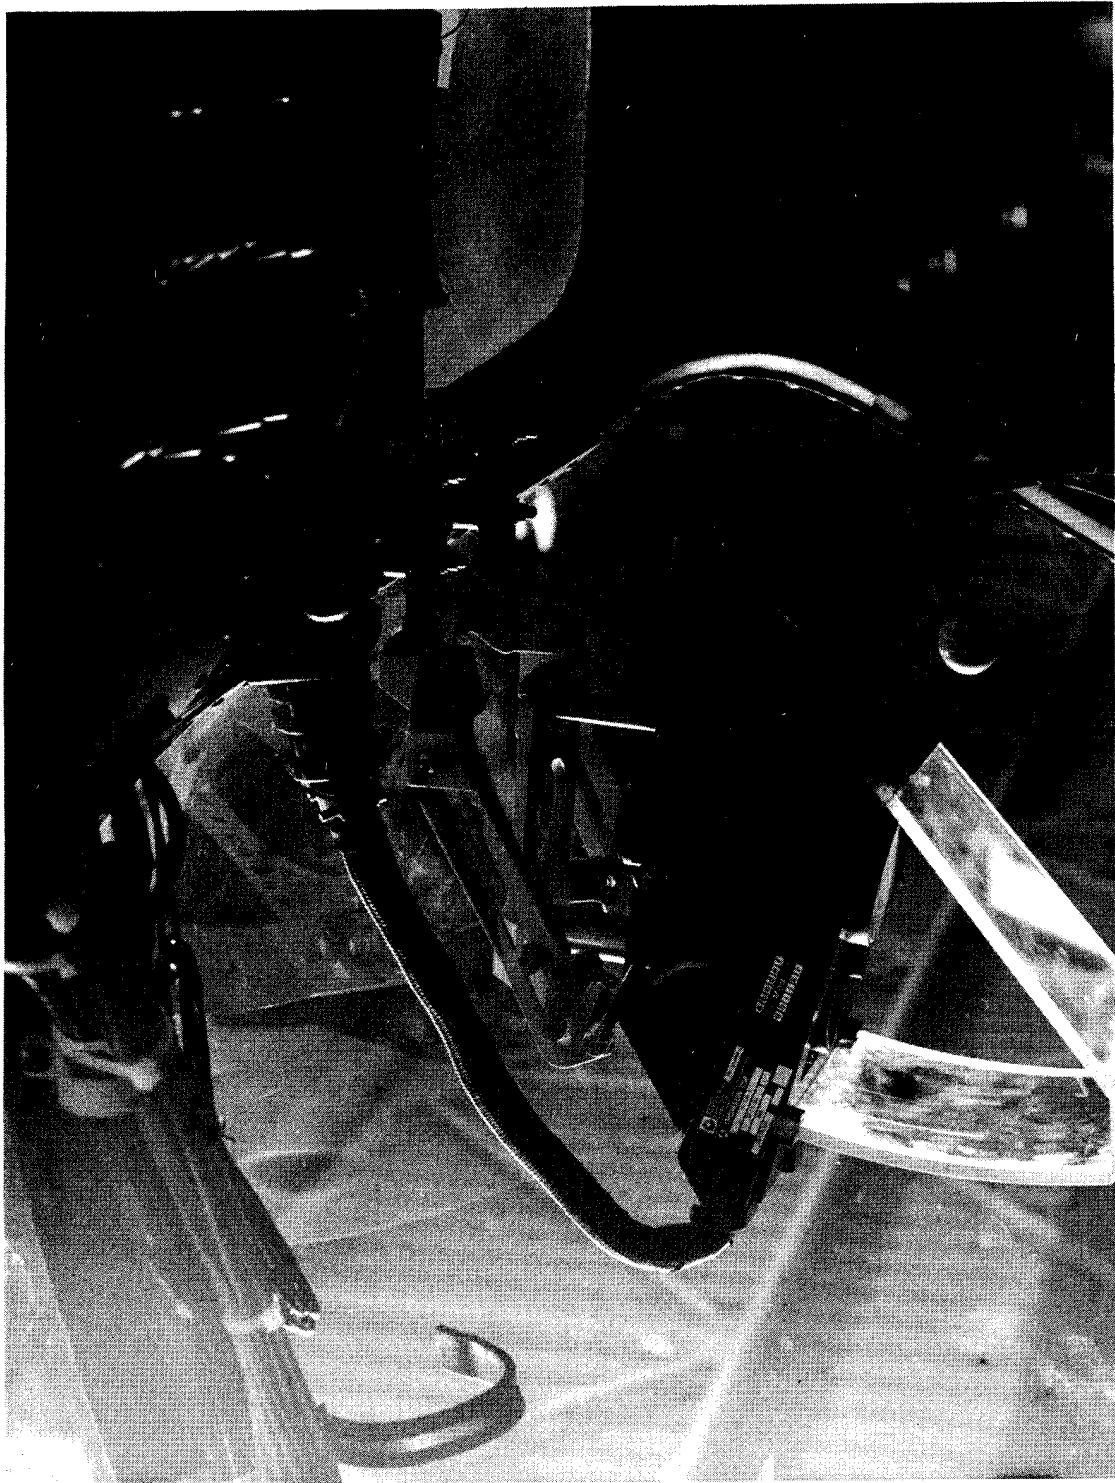



Figure 1. Left side view of PDU installation, breakaway position shown.




**Figure 2.** Front view of PDU installation, normal in-use position shown.

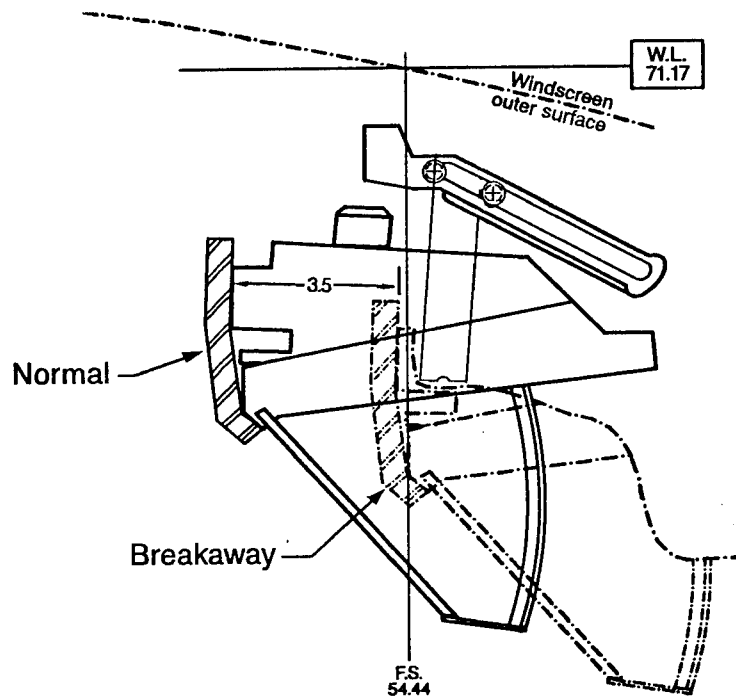

**Figure 3.** Profile sketch of PDU location in OH-58 cockpit showing the normal and crash breakaway position.

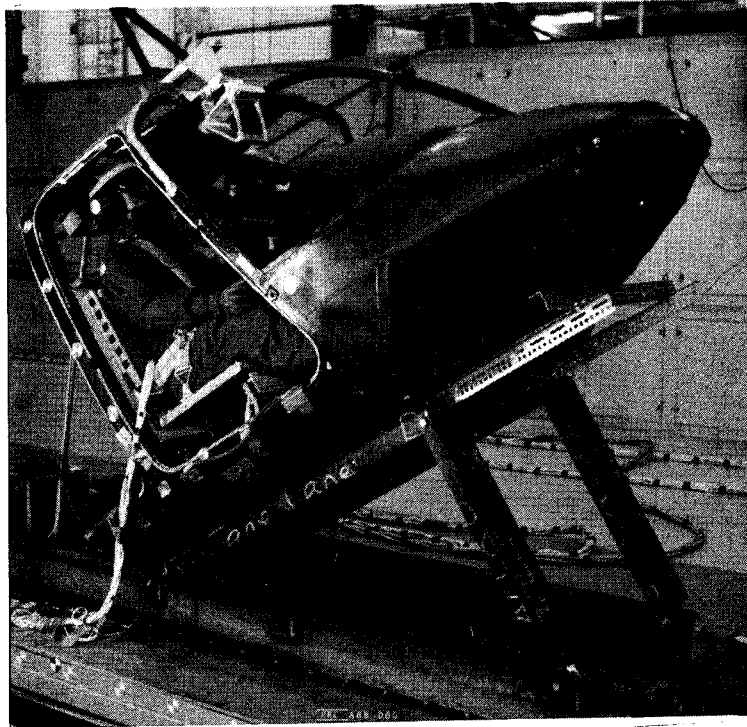

**Figure 4.** Pretest view of no. 88060; note the absence of crashworthy seat cushion and the dummy PDU and mount.

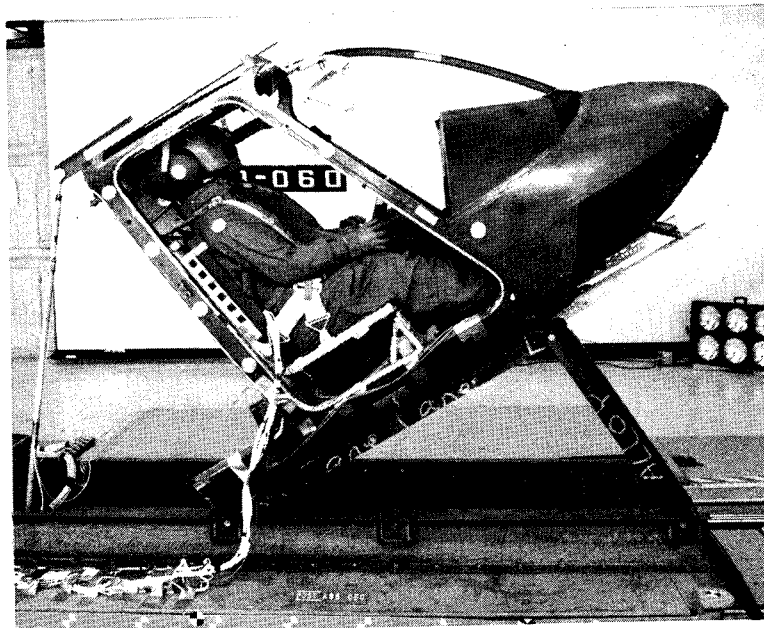

**Figure 5.** Posttest view of no. 88060; note the rearward rotation of helmet after rebound.

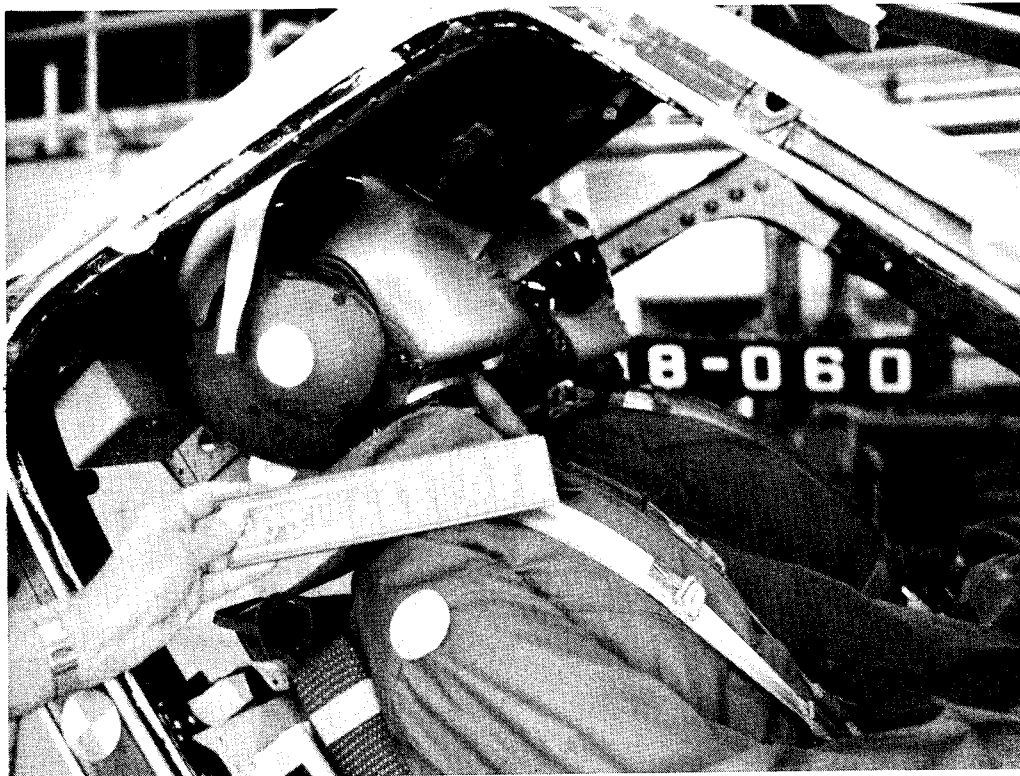


Figure 6. Posttest view of 50th percentile dummy; note helmet rotated until stopped by nape strap.

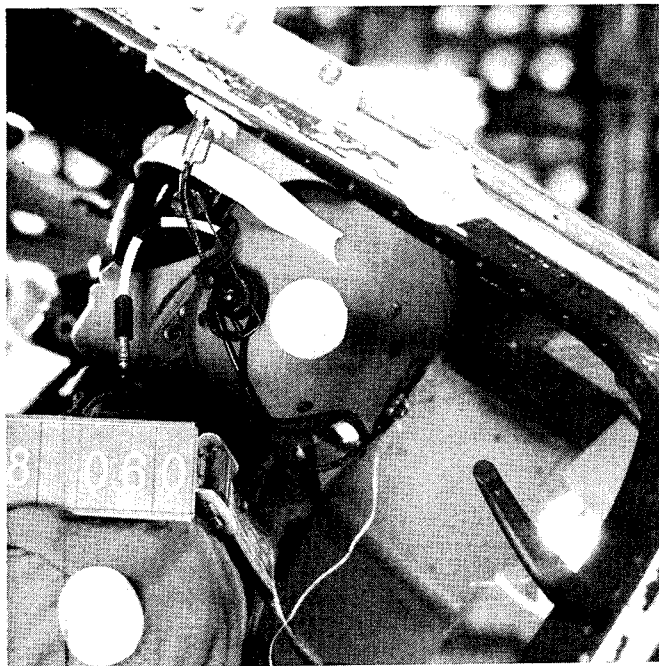


Figure 7. Posttest view of 95th percentile dummy in left seat.



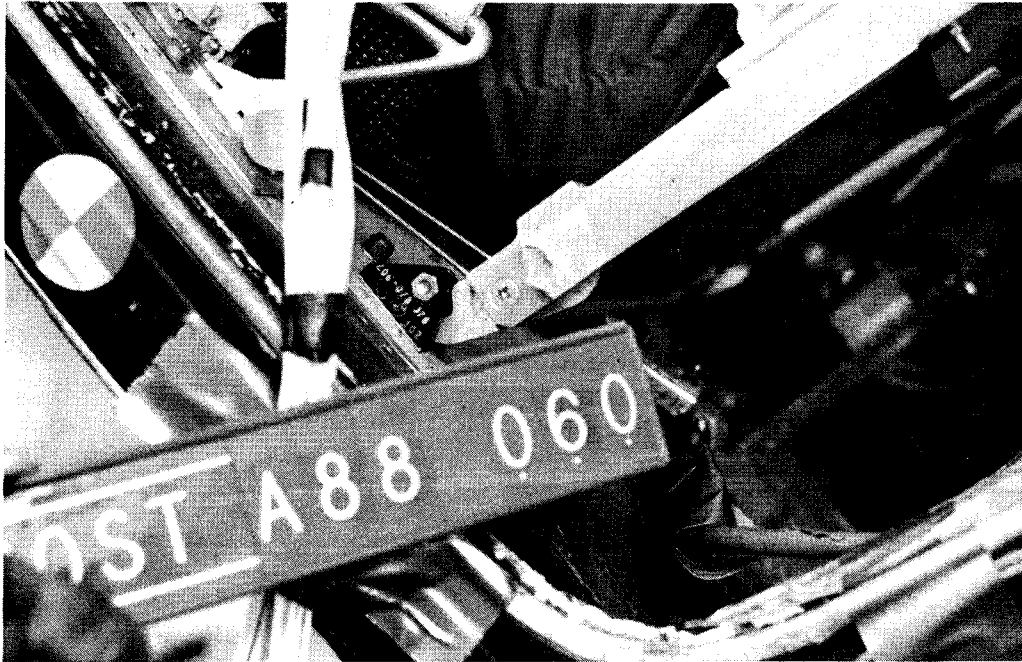


Figure 8. Seat pan downward displacement of 0.3 inch shown between latch and bulkhead support, right side.

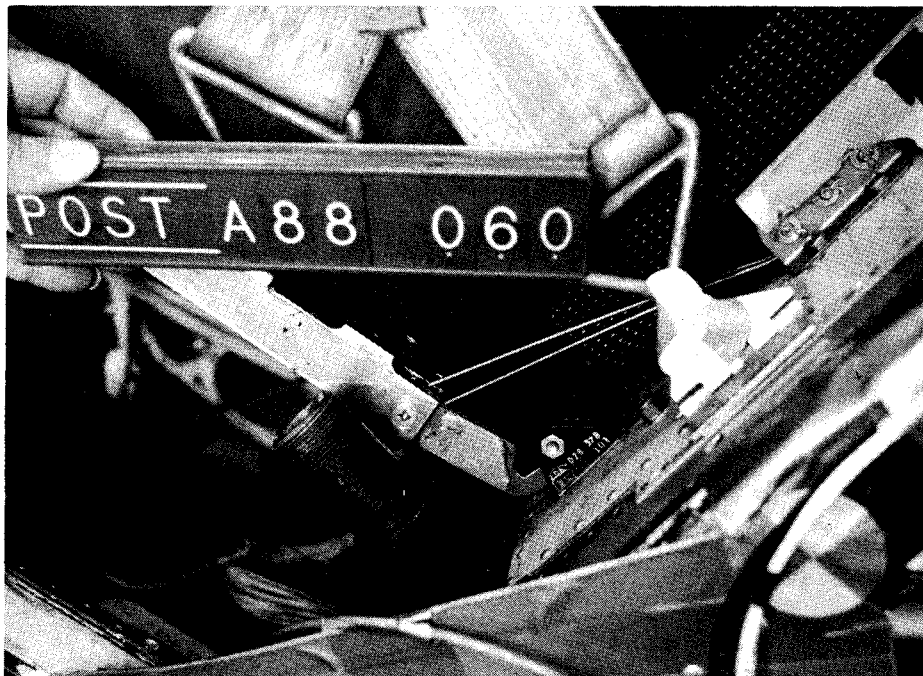


Figure 9. Seat pan downward displacement of 0.6 inch shown between latch and bulkhead support, left side.

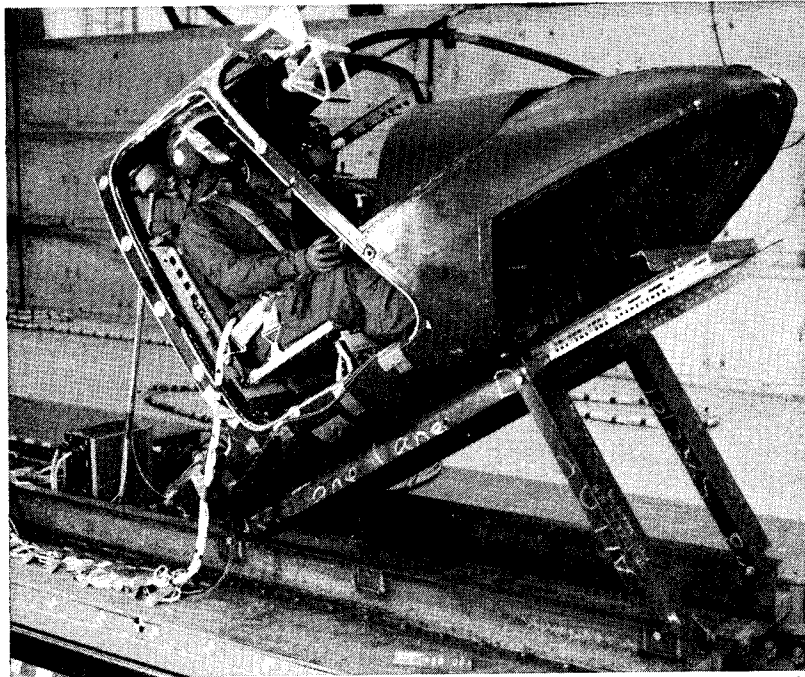


Figure 10. Pretest view of CAMI 88061; note aluminum strap on inside of left door frame and steel strap on right seat.

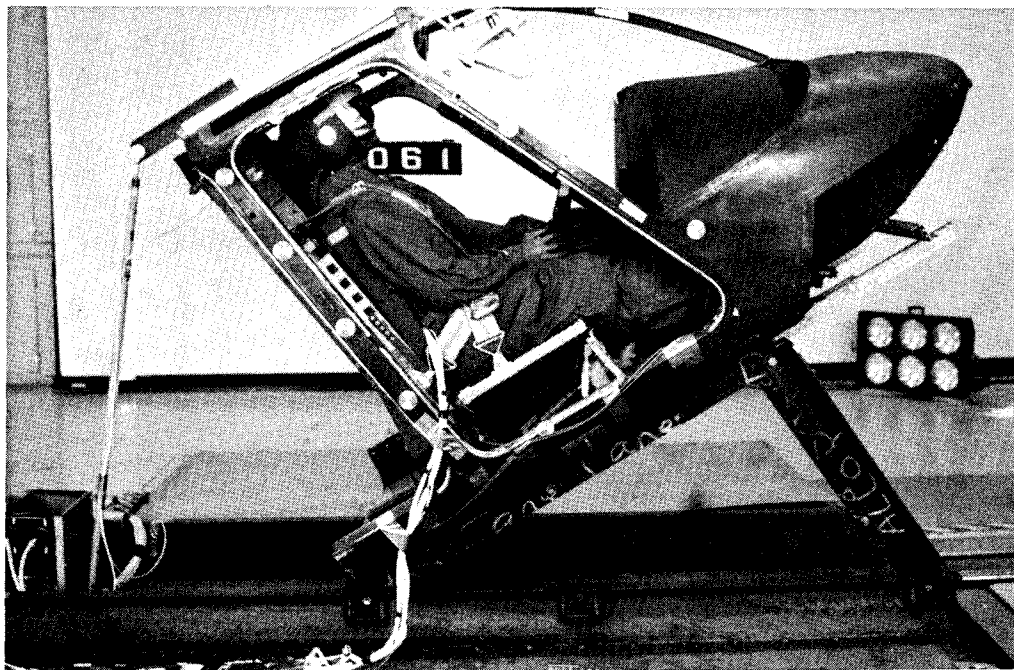


Figure 11. Posttest view of CAMI 88061; note that helmet has not rotated due to tape under chin.



Figure 12. Pretest of no. 88062; note potentiometer cable attached to back of helmet.



Figure 13. Pretest view of no. 88062; note board placed at back of seat to place right dummy 1.5-inch forward.

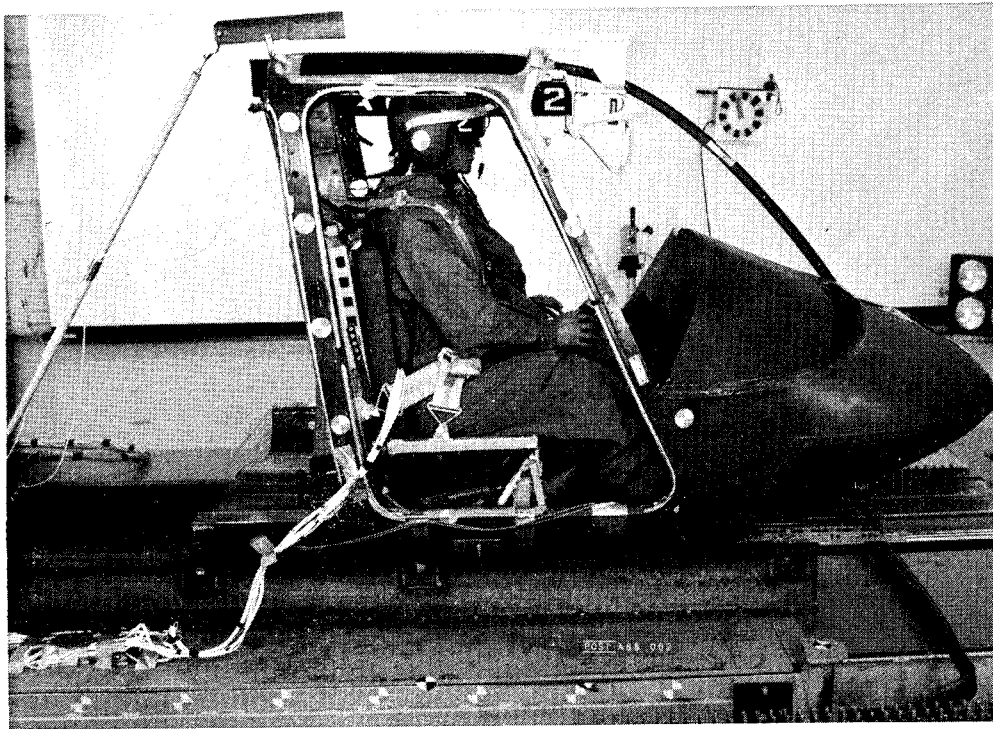


Figure 14. Posttest view of no. 88062; note rebound position of sled about 1 foot from displaced  $\frac{1}{4}$ -inch diameter cable.

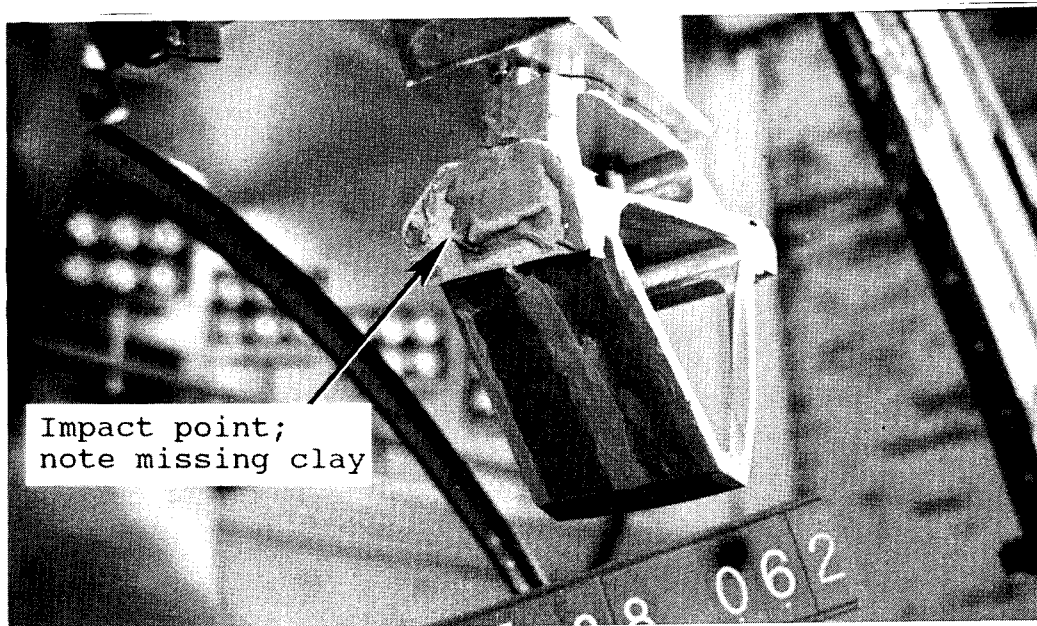


Figure 15. Posttest view of no. 88062; note missing clay which was found on helmet of right dummy.

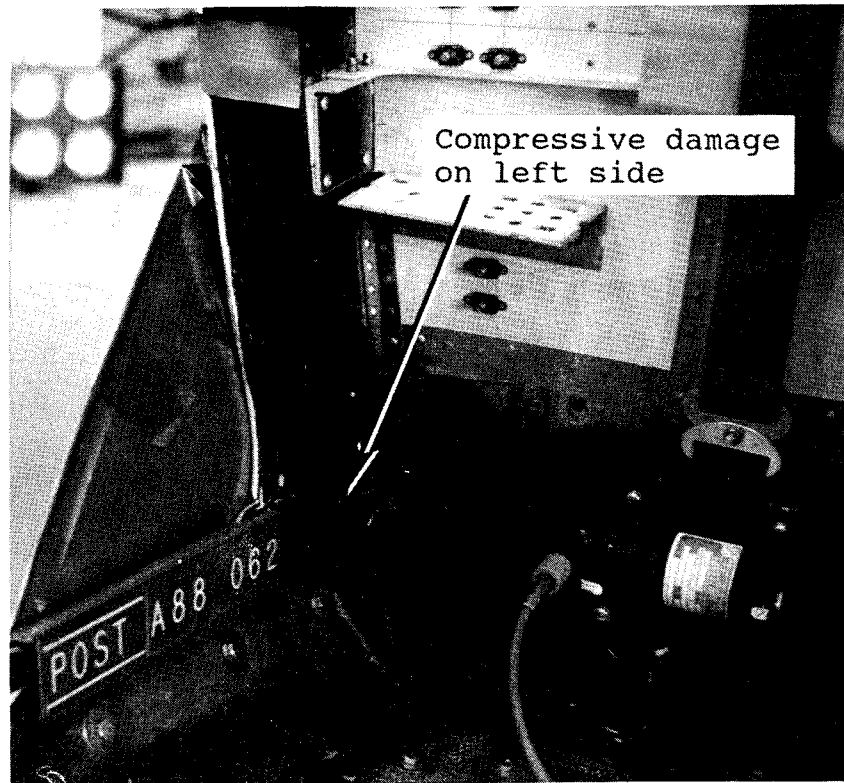


Figure 16. Posttest of no. 88062; note buckled "box" section of fuselage station 73.04 bulkhead.

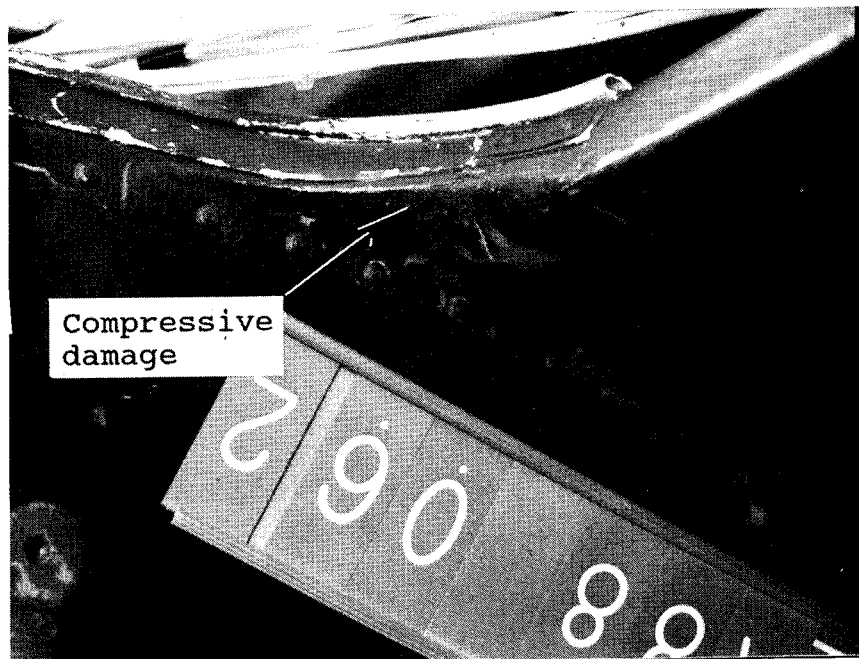


Figure 17. Posttest view of no. 88062; note buckled skin adjacent to "box" section of fuselage station 73.04 bulkhead.

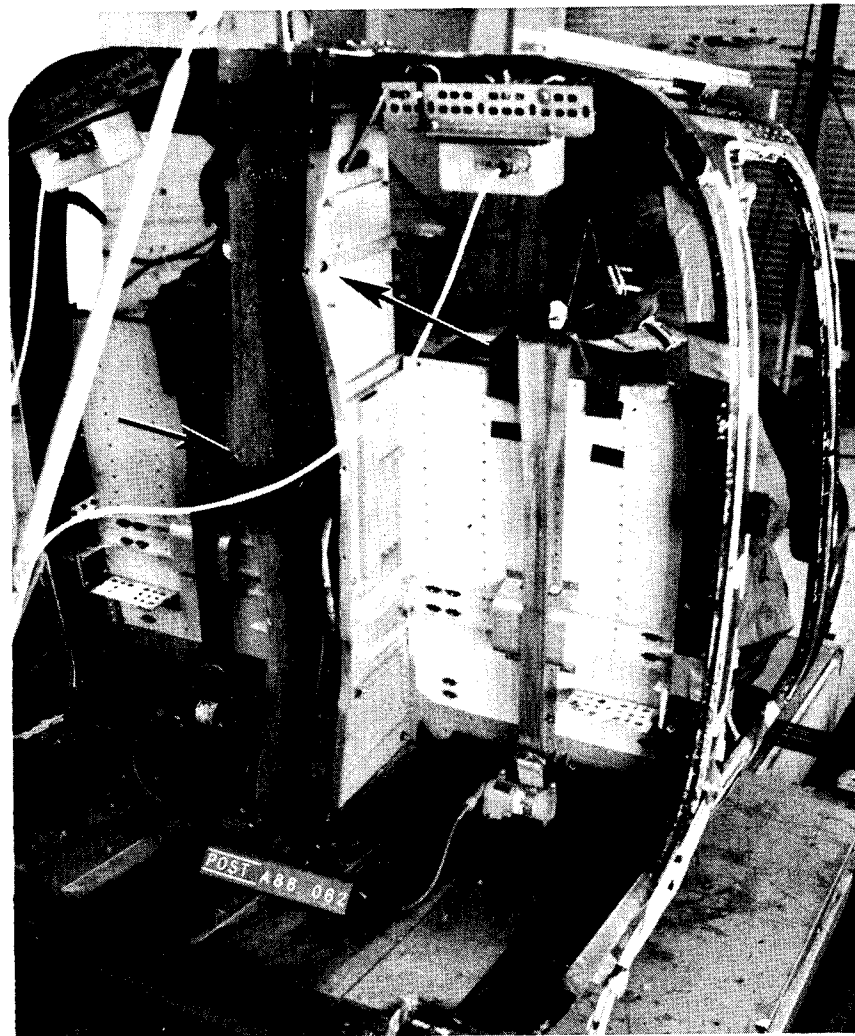


Figure 18. Posttest view of fuselage station 73.04 bulkhead; note buckles in control closet structure by arrows.

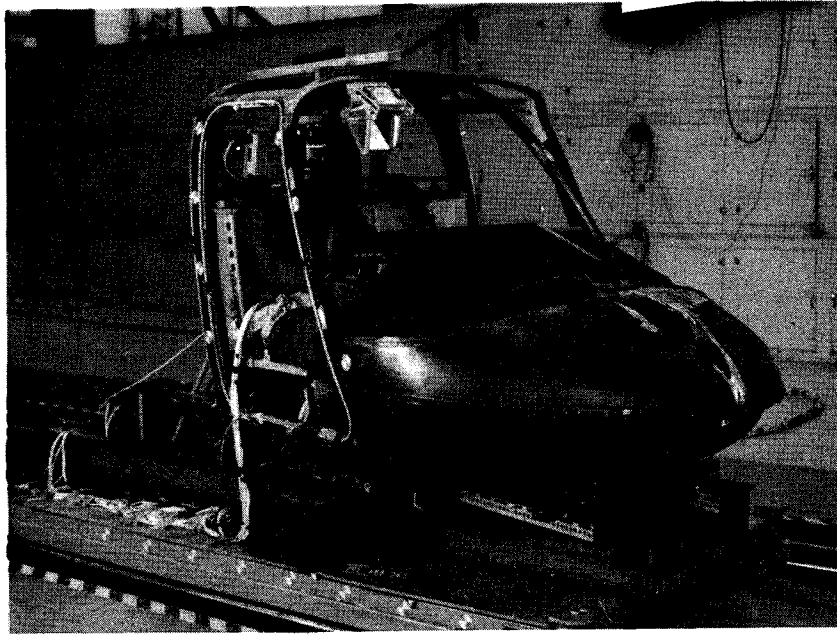


Figure 19. Pretest view of no. 88063; note 15-degree right yaw orientation, and prior damage to nose structure.

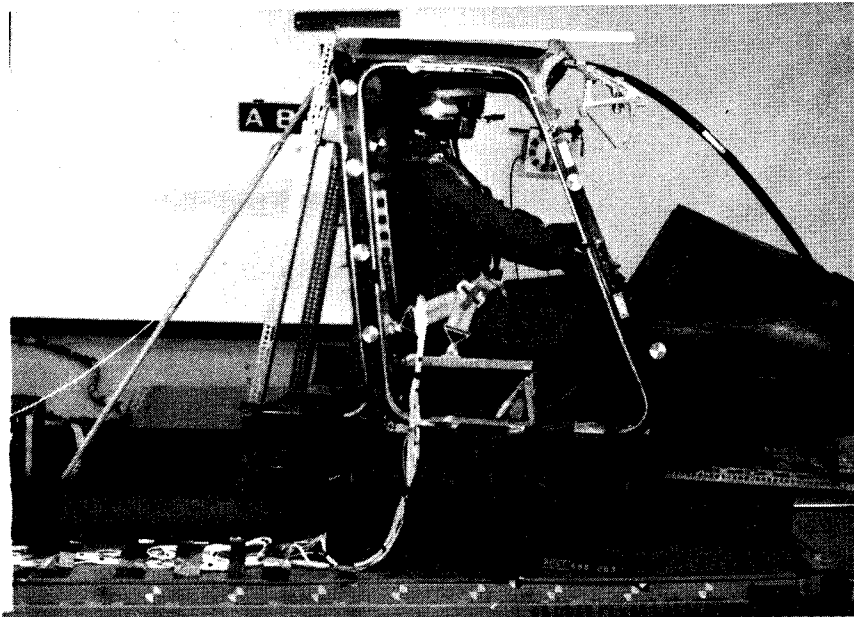


Figure 20. Posttest view of no. 88063; note the actual production PDU mount in place and bulkhead 73.04 reinforcement.

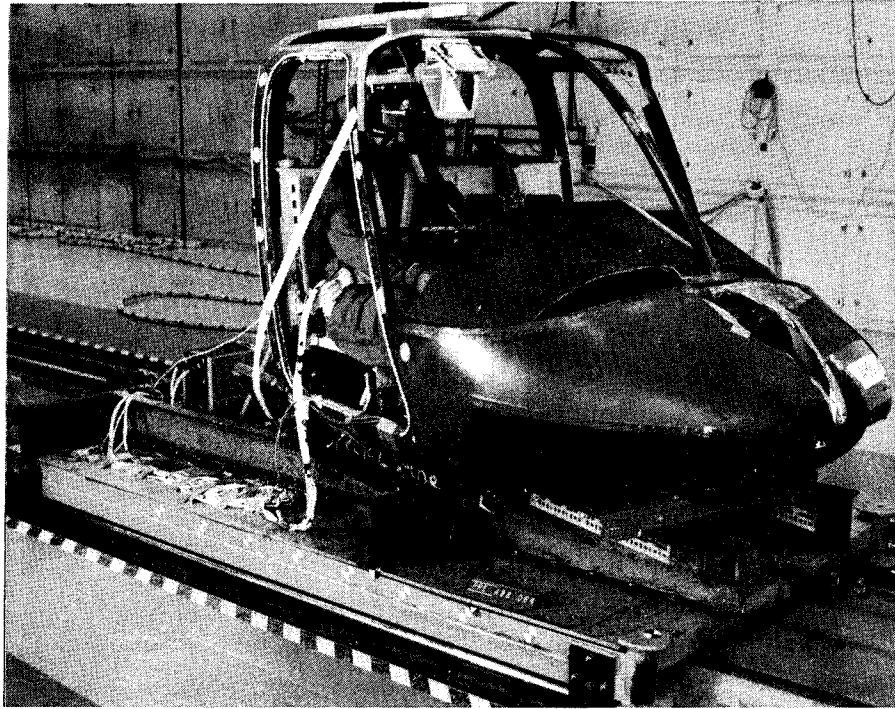


Figure 21. Pretest view of no. 88064; note diagonal aluminum strap added to prevent forward movement of upper door post.

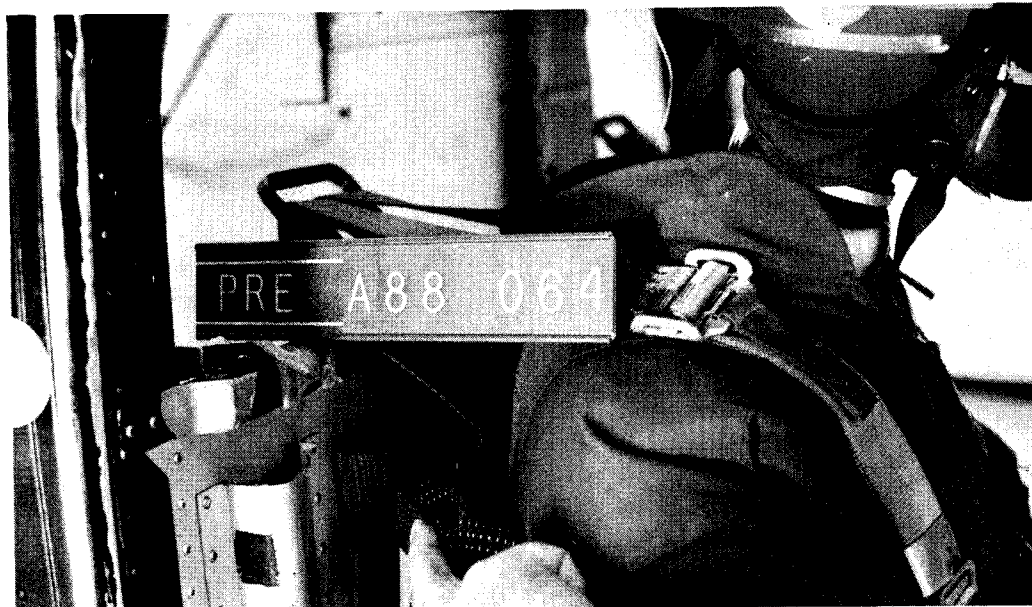


Figure 22. Pretest view of no. 88064; note board behind back cushion to move dummy forward 1.5 inch.



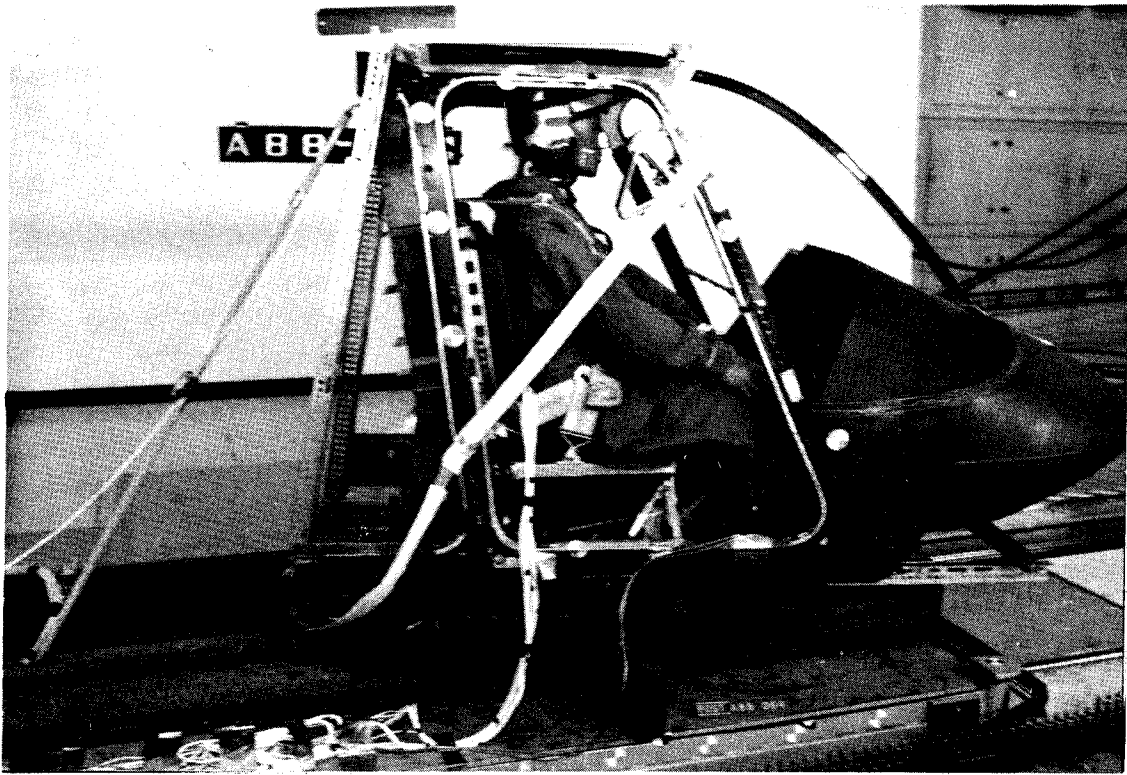


Figure 23. Posttest view of no. 88064; note limp, stretched aluminum diagonal strap, and PDU mount detachment.



Figure 24. Posttest view of no. 88064; note detached PDU "breakaway" mount and cracked foam at back edge of PDU.



Figure 25. Posttest view of no. 88064; arrow denotes cracked helmet visor cover.

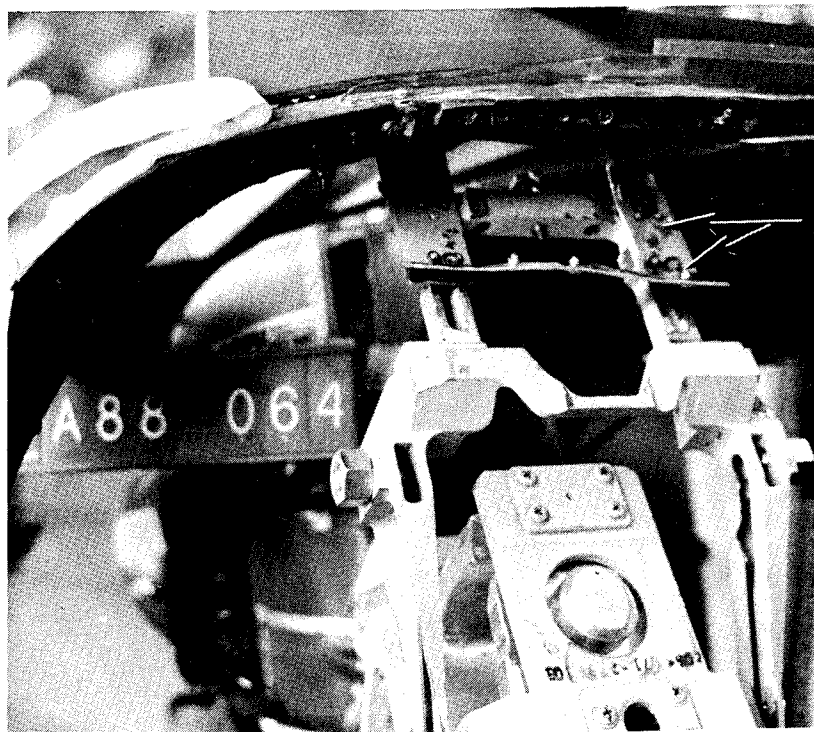


Figure 26. Posttest view of no. 88064; arrow denotes failed rivets which help to secure the PDU breakaway mount.

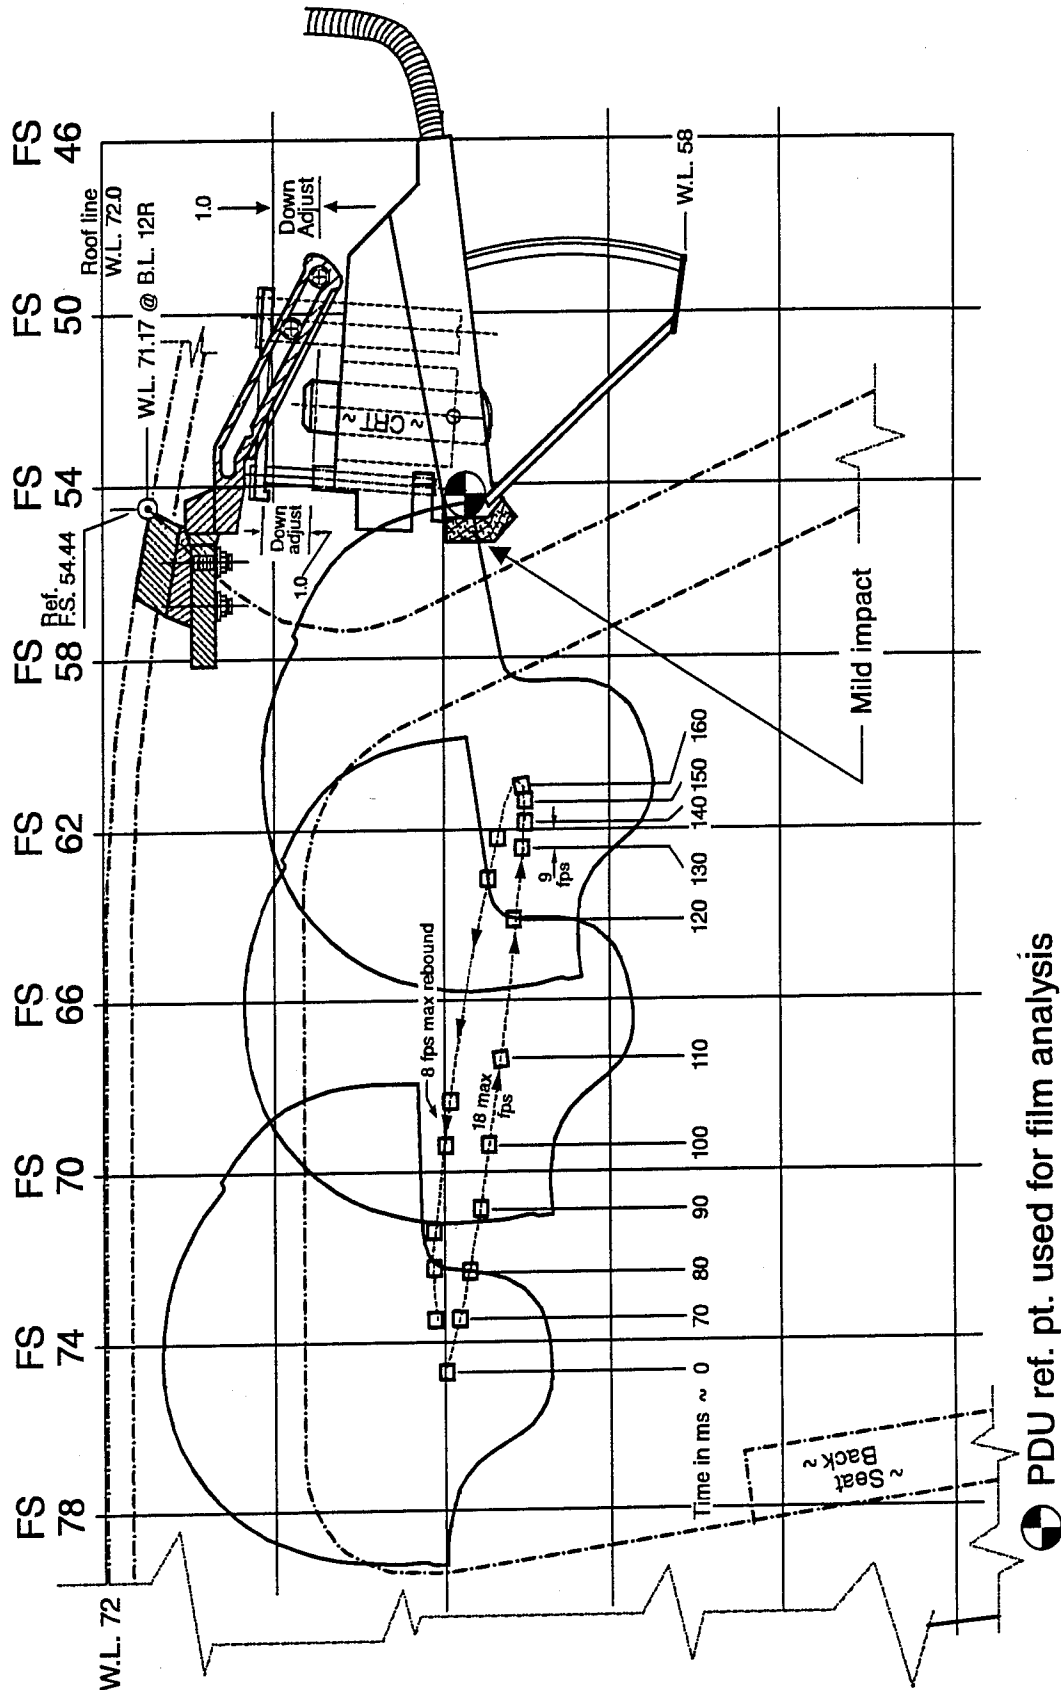


Figure 27. Helmeted head displacement in 30-degree pitch down test 88060.

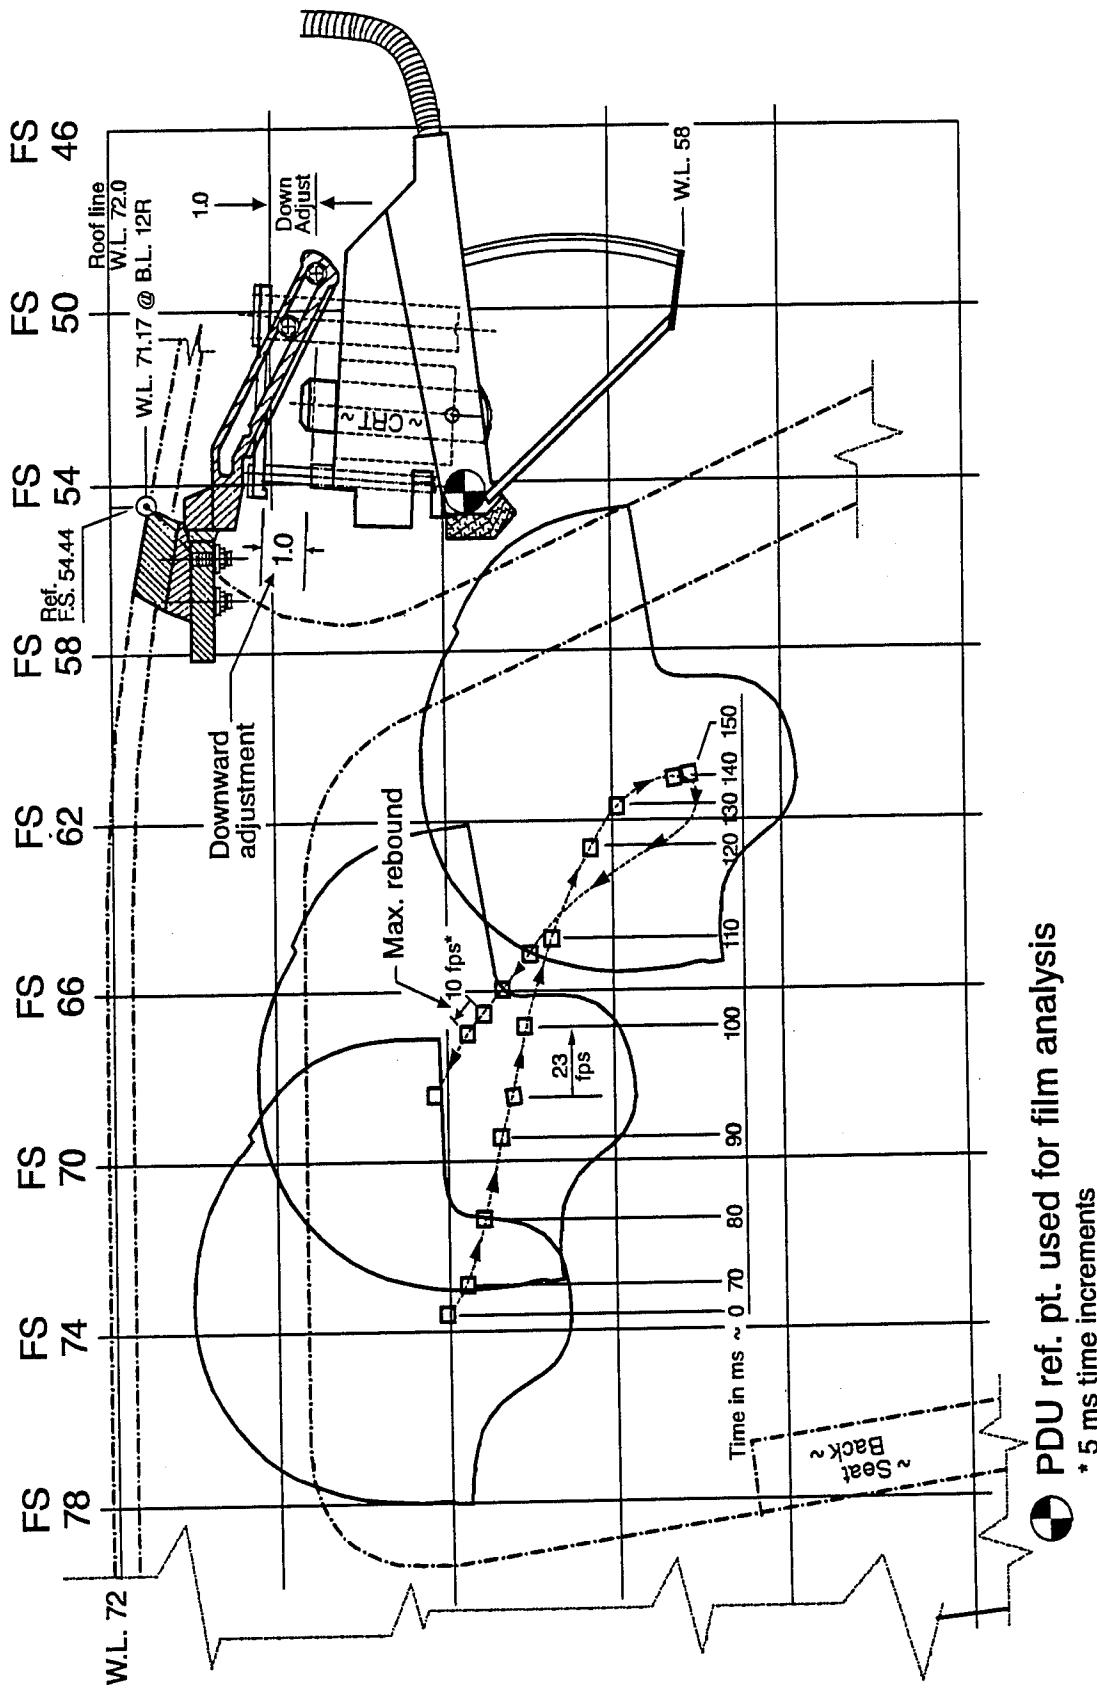


Figure 28. Helmeted head displacement in second 30-degree pitch down test 88061.


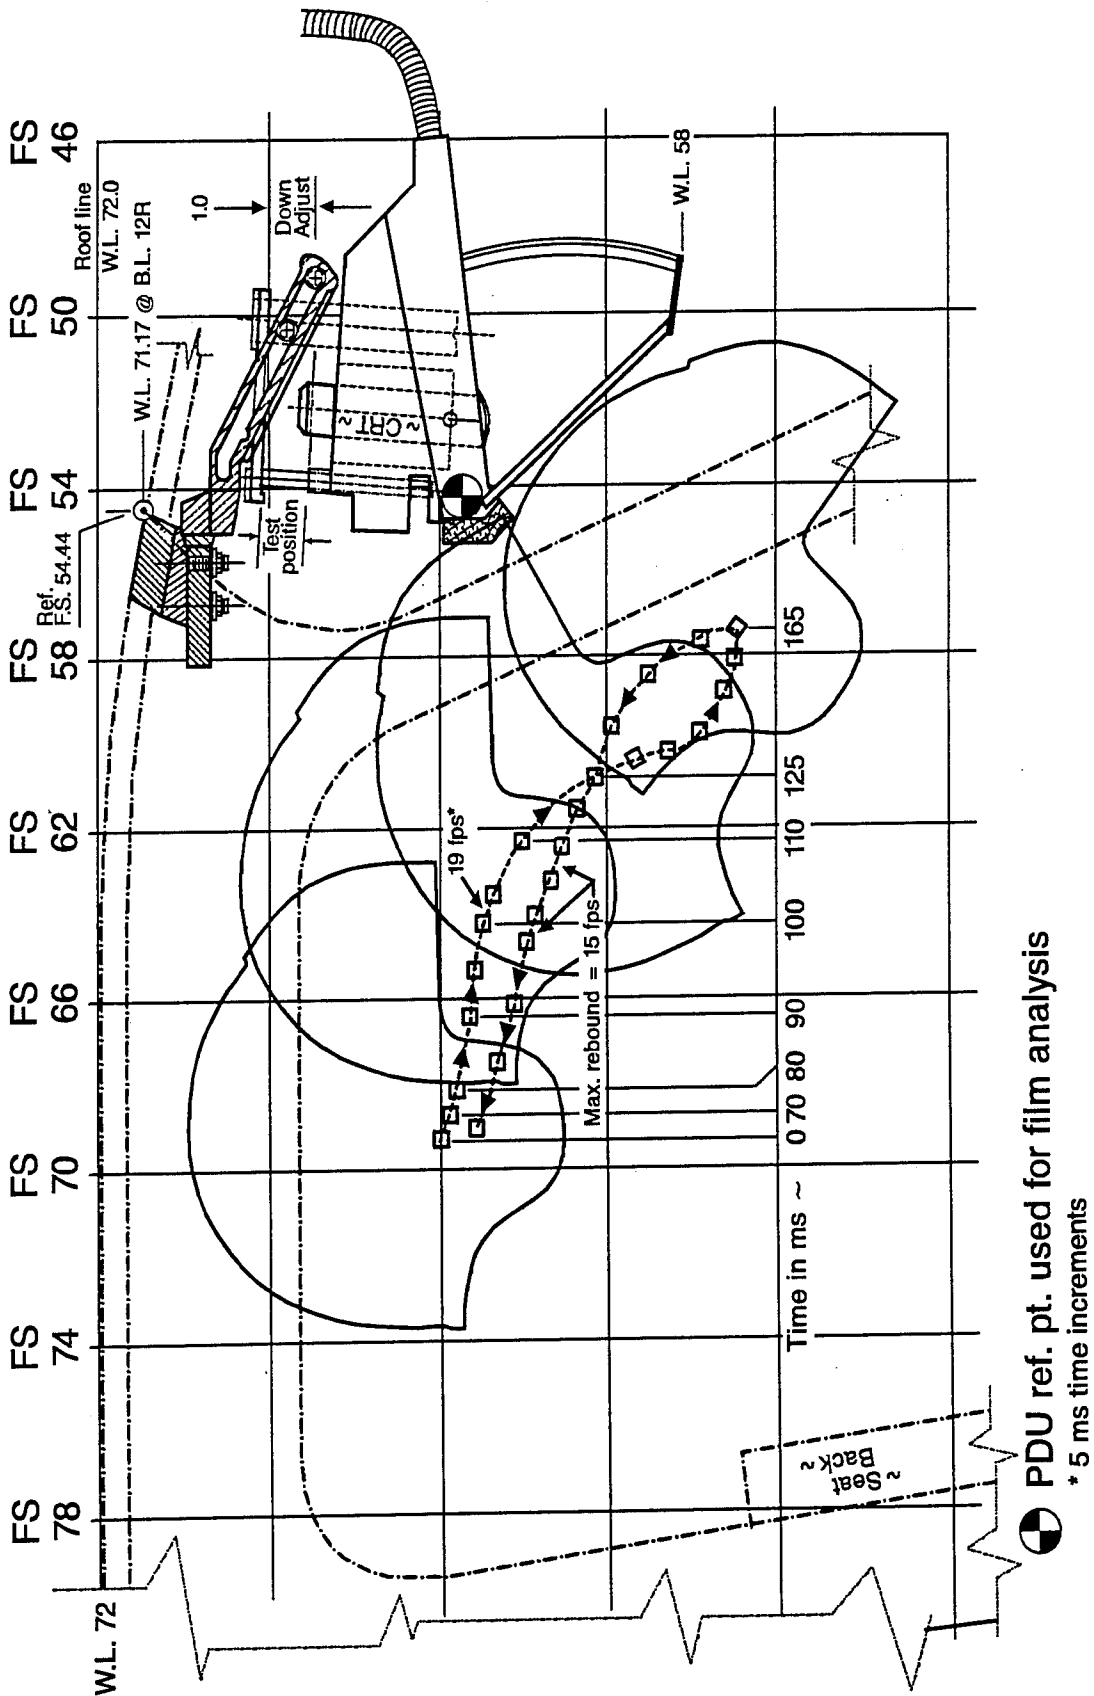



Figure 29. Helmeted head displacement in horizontal (x-axis) test 88062.

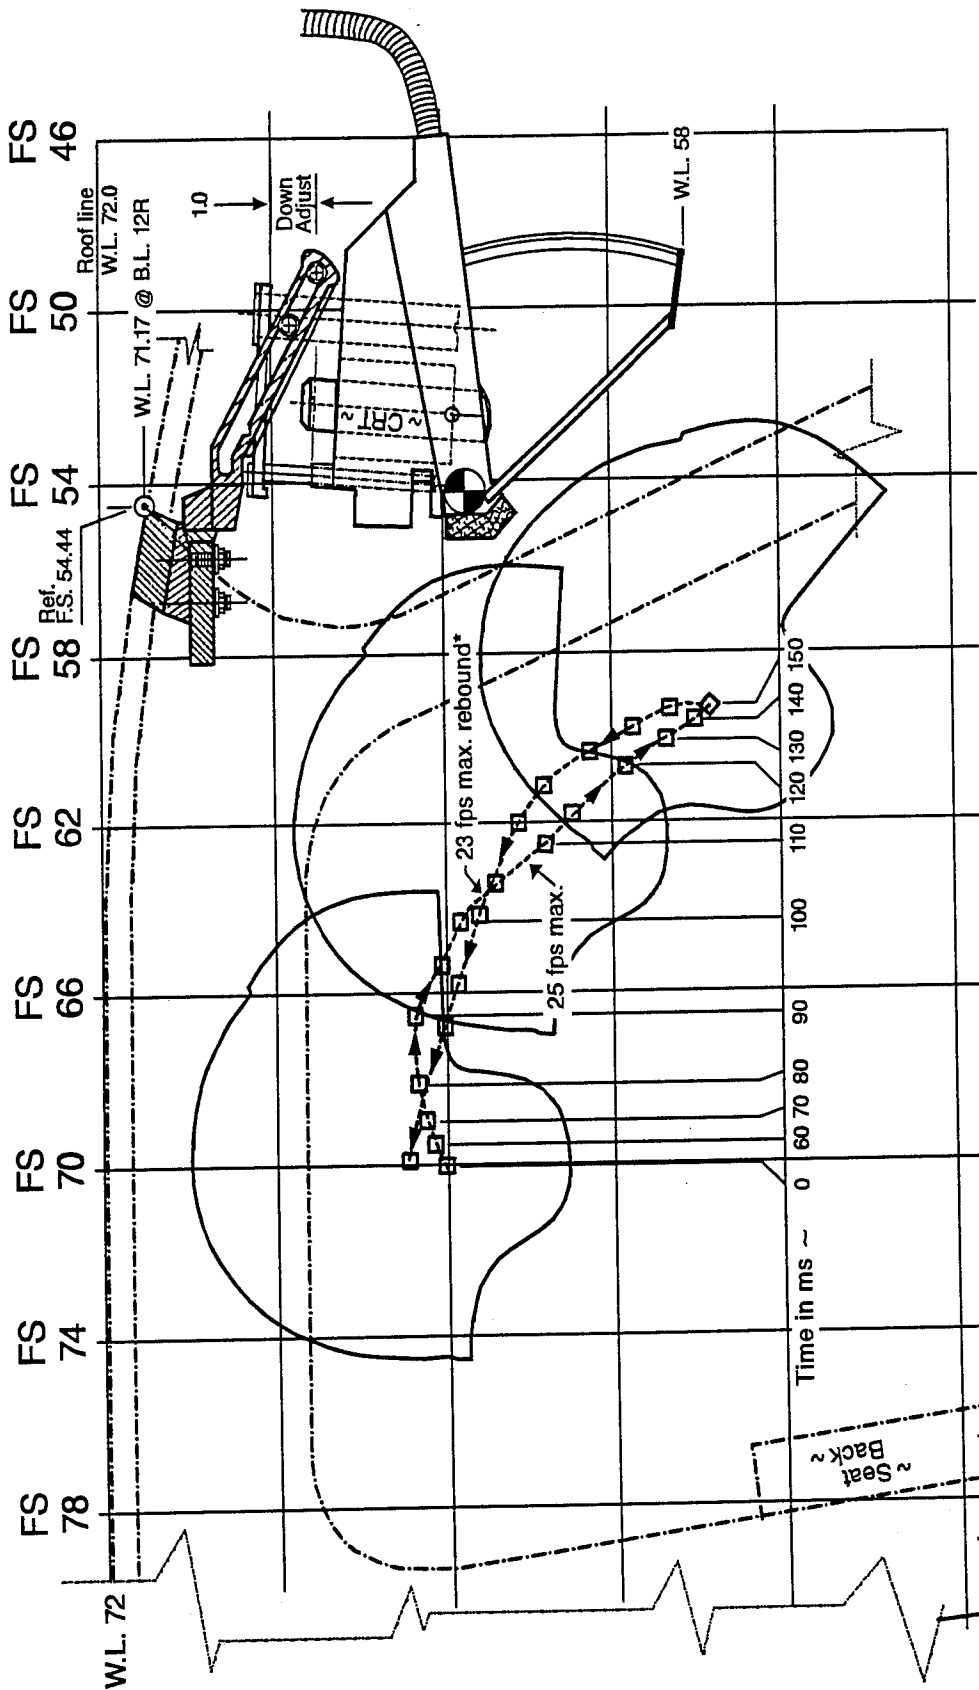


**PDU ref. pt. used for film analysis**  
 \* 5 ms time increments

- Notes: (1) PDU shown in "breakaway" position, but was located in the rear IN-USE position at time zero.  
 (2) Displacement along X-axis was found by correcting calculated distance from film analysis by the cosine of the 15° yaw angle.

Figure 30. Helmeted head displacement in x-axis, 15-degree yaw, test 88063.

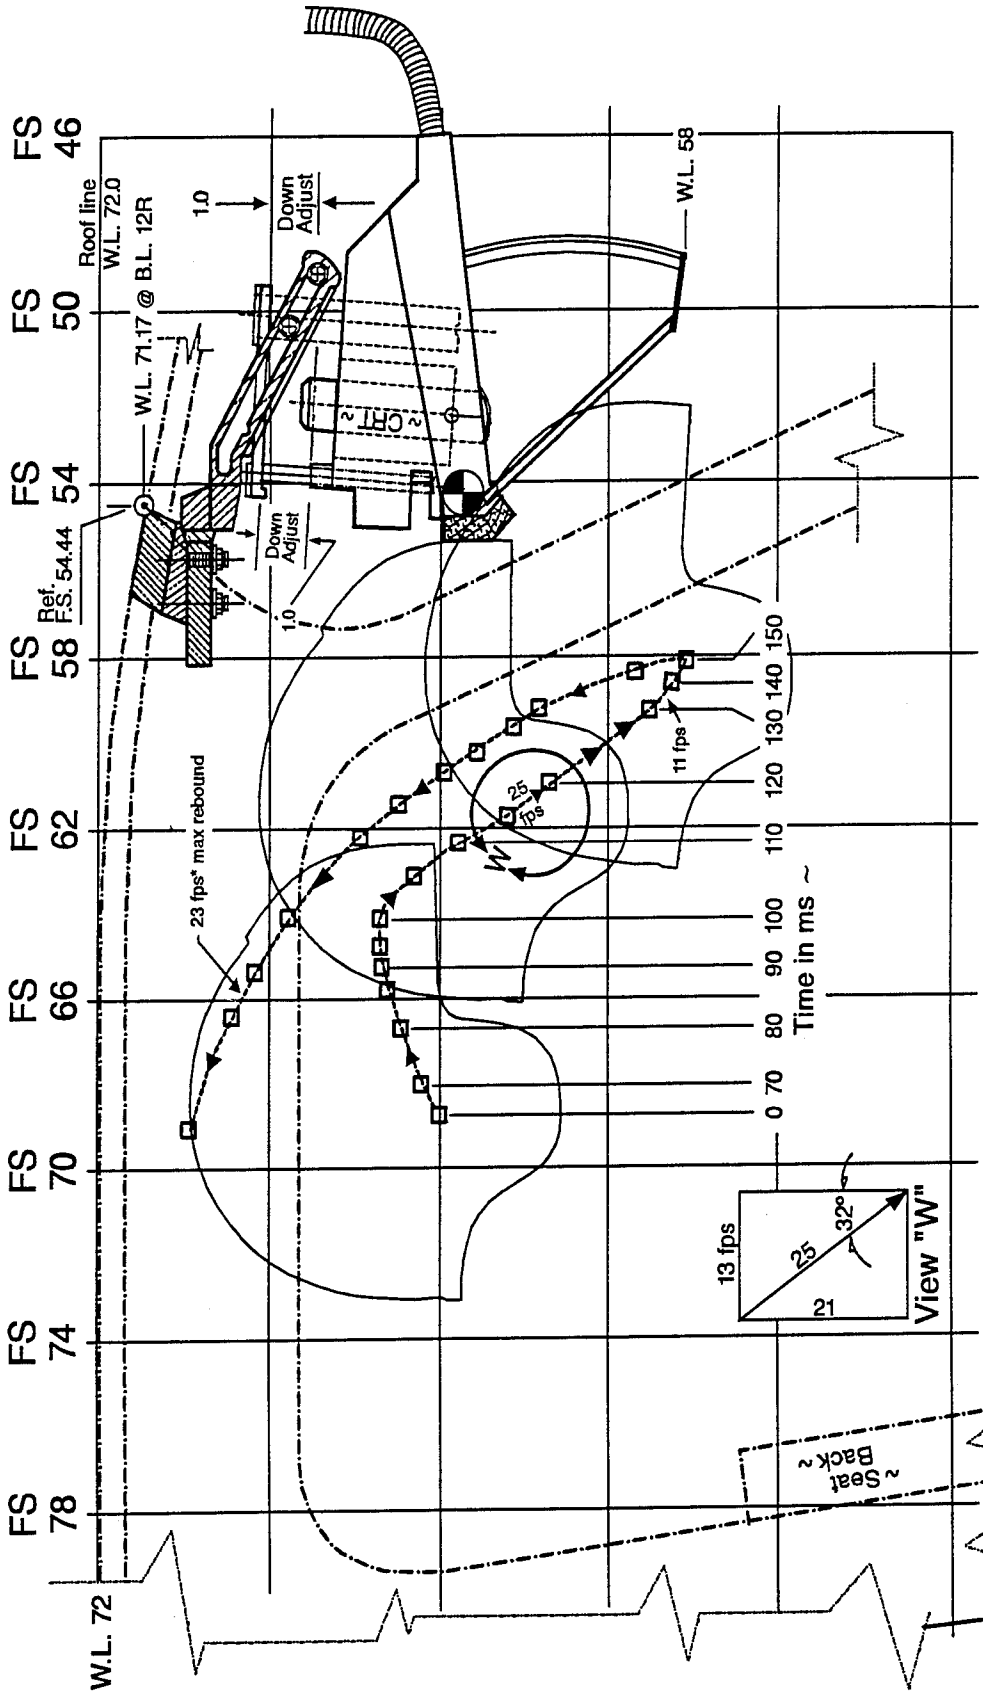

**PDU ref. pt. used for film analysis**

\* 5 ms time increments

- Notes: (1) PDU shown in "breakaway" position, but was located in the rear IN-USE position at time zero.  
 (2) Displacement along X-axis was found by correcting calculated distance from film analysis by the cosine of the 15° yaw angle.

Figure 31. Helmeted head displacement in horizontal (x-axis) with 15-degree right yaw, test 88064.

Appendix A.

Pilot display unit transducer results for  
tests 88060, 88061, 88062, 88063, and 88064.



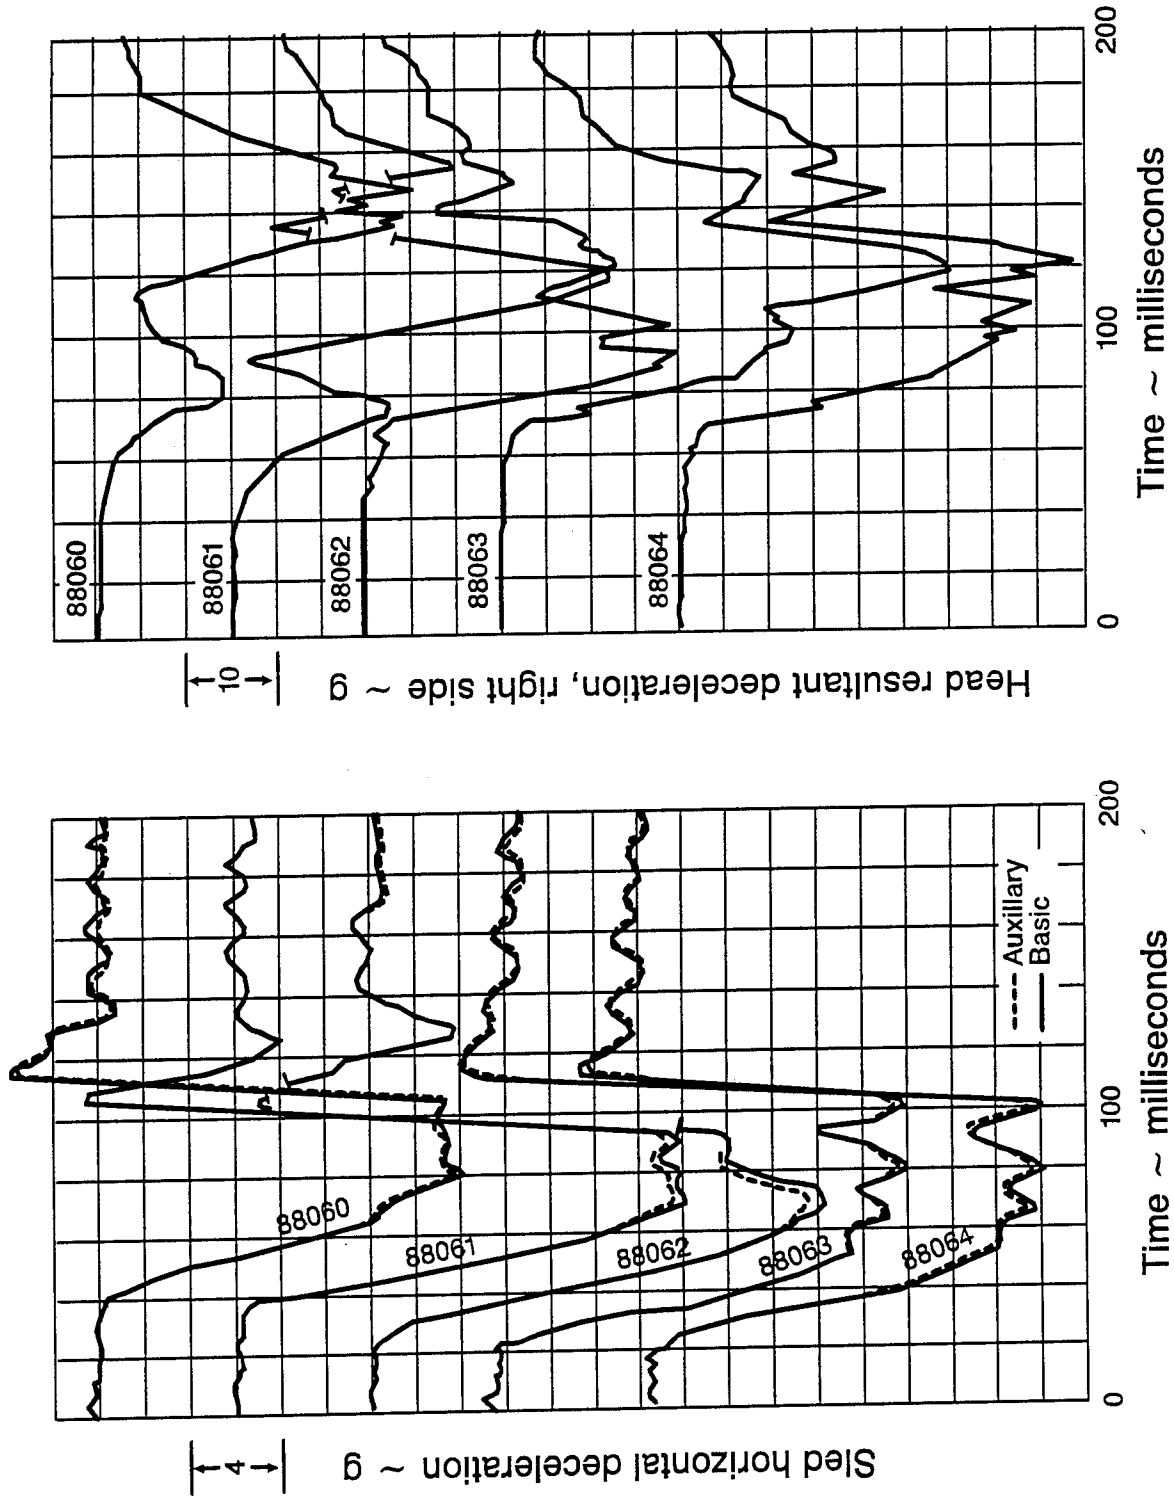


Figure A-1. Sled and right seat dummy head deceleration traces from five PDU tests.

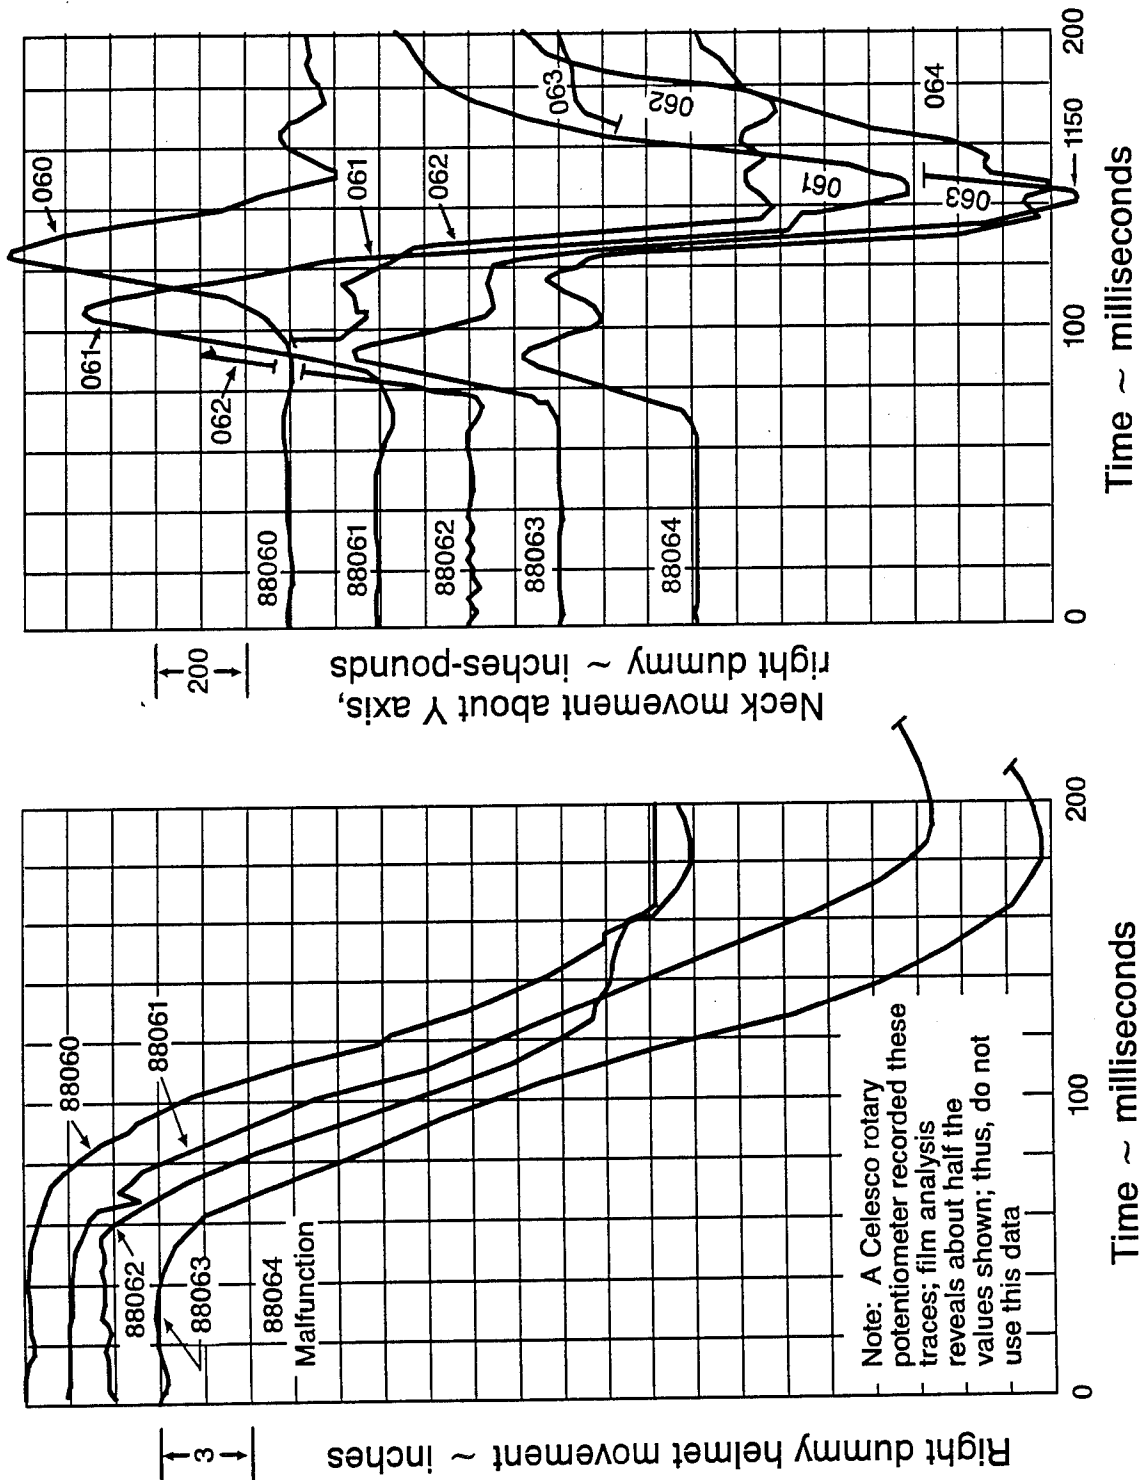


Figure A-2. Right dummy helmet displacement and neck moment about the y-axis for five PDU tests.

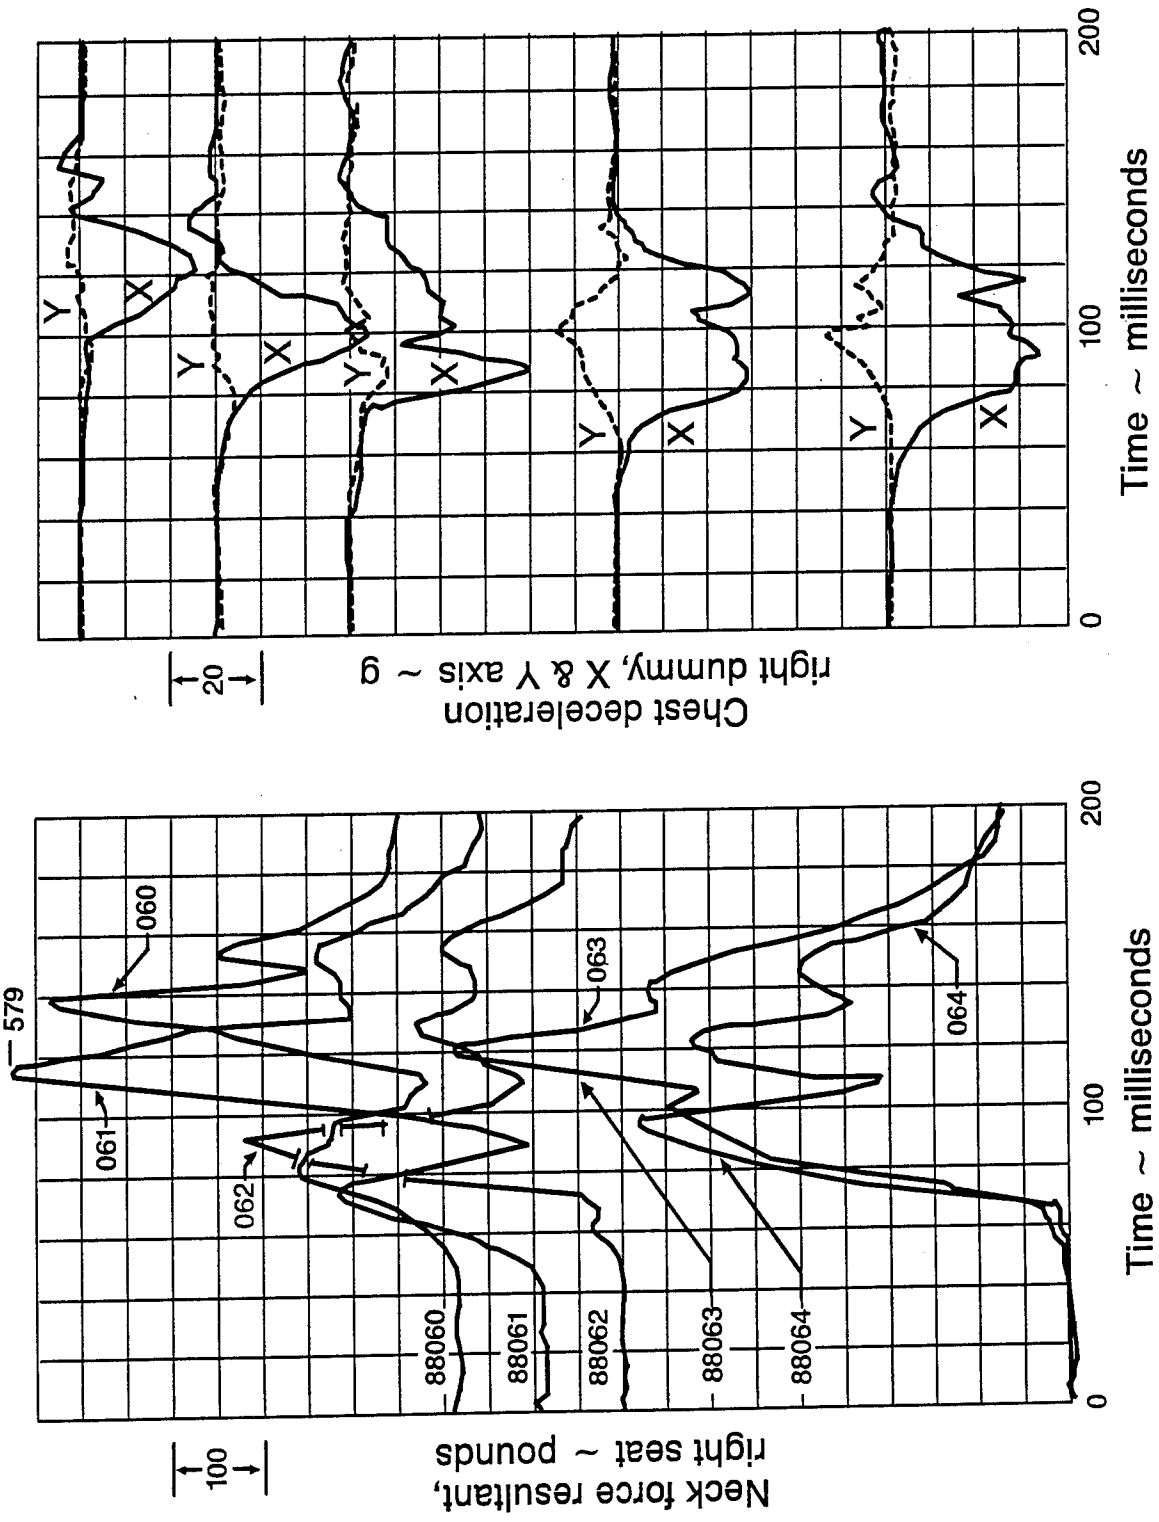


Figure A-3. Right dummy neck force and chest deceleration for all five PDU tests.

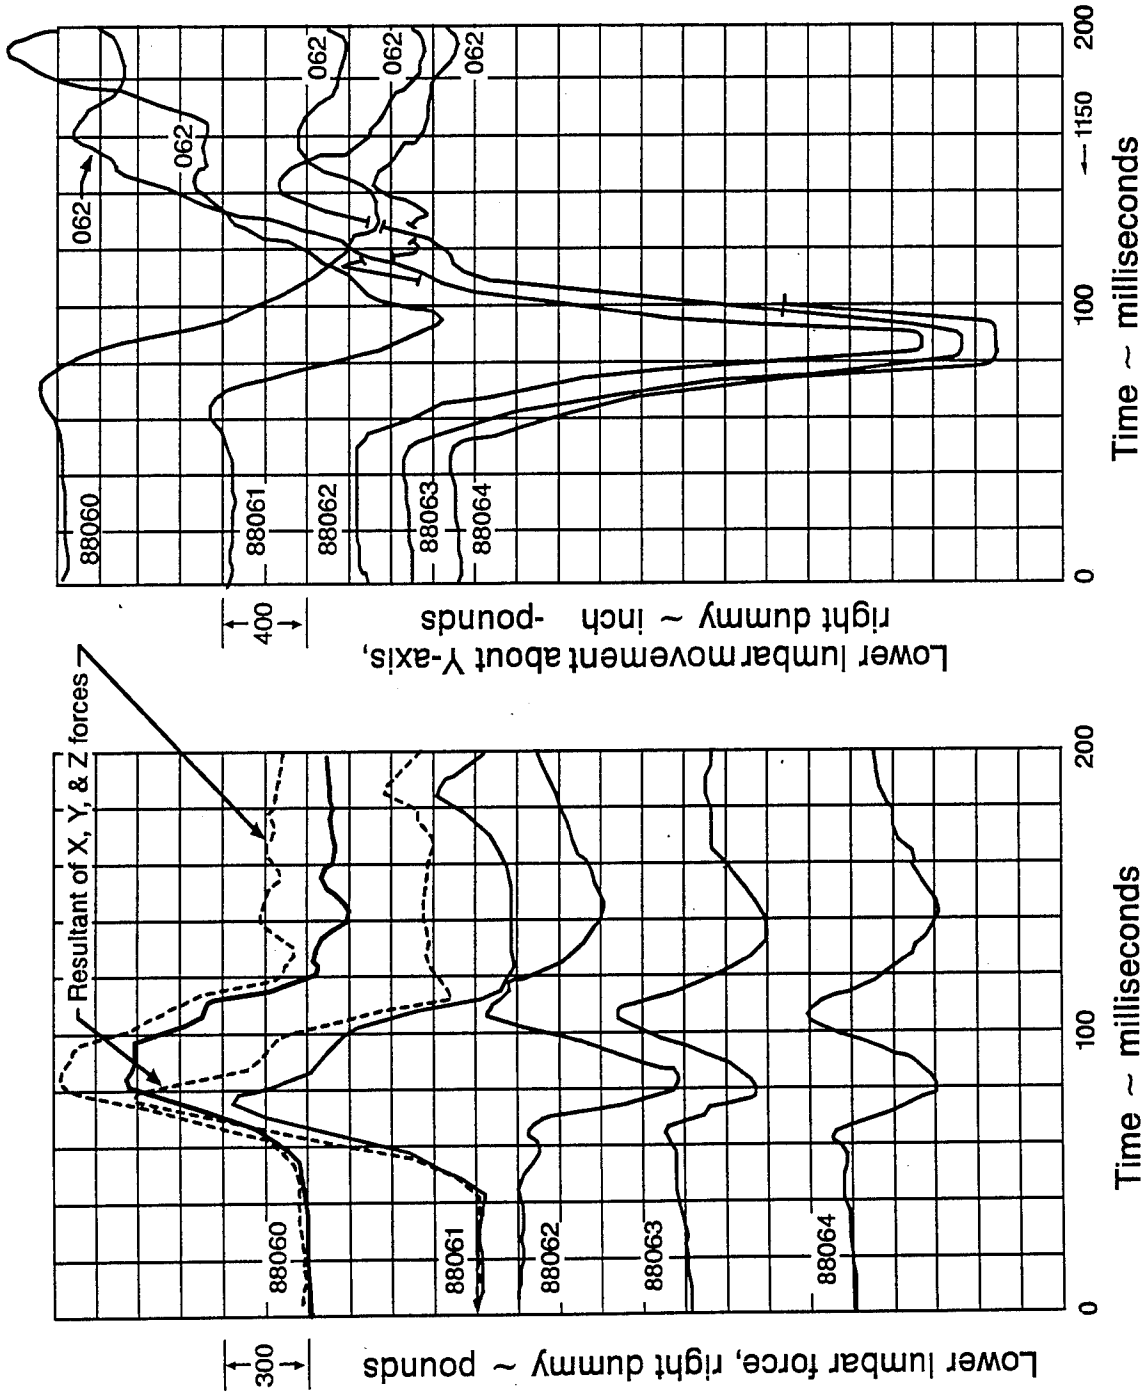


Figure A-4. Lumbar force and moment traces for all PDU tests.

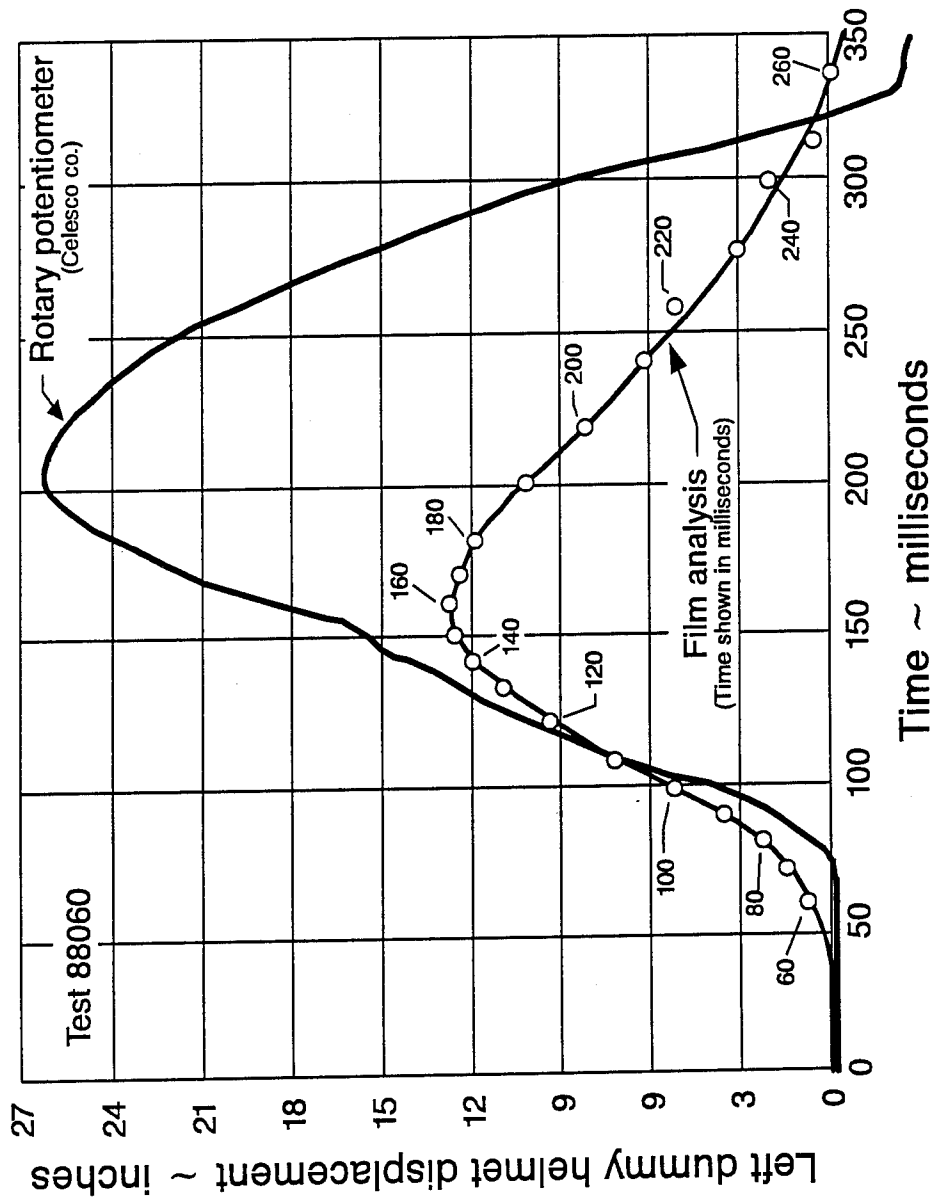


Figure A-5. Comparison of left dummy helmet displacement in test 88060: rotary potentiometer vs. film analysis.

Appendix B.

Manufacturers' list

B. F. Goodrich Chemical Company  
Cleveland, OH 44115

NAC Visual Systems  
6307-K DeSoto Avenue  
Woodland Hills, CA 91367

Initial distribution

Commander, U.S. Army Natick Research,  
Development and Engineering Center  
ATTN: SATNC-MIL (Documents  
Librarian)  
Natick, MA 01760-5040

Chairman  
National Transportation Safety Board  
800 Independence Avenue, S.W.  
Washington, DC 20594

Commander  
10th Medical Laboratory  
ATTN: Audiologist  
APO New York 09180

Naval Air Development Center  
Technical Information Division  
Technical Support Detachment  
Warminster, PA 18974

Commanding Officer, Naval Medical  
Research and Development Command  
National Naval Medical Center  
Bethesda, MD 20814-5044

Deputy Director, Defense Research  
and Engineering  
ATTN: Military Assistant  
for Medical and Life Sciences  
Washington, DC 20301-3080

Commander, U.S. Army Research  
Institute of Environmental Medicine  
Natick, MA 01760

Library  
Naval Submarine Medical Research Lab  
Box 900, Naval Sub Base  
Groton, CT 06349-5900

Executive Director, U.S. Army Human  
Research and Engineering Directorate  
ATTN: Technical Library  
Aberdeen Proving Ground, MD 21005

Commander  
Man-Machine Integration System  
Code 602  
Naval Air Development Center  
Warminster, PA 18974

Commander  
Naval Air Development Center  
ATTN: Code 602-B  
Warminster, PA 18974

Commanding Officer  
Armstrong Laboratory  
Wright-Patterson  
Air Force Base, OH 45433-6573

Director  
Army Audiology and Speech Center  
Walter Reed Army Medical Center  
Washington, DC 20307-5001

Commander/Director  
U.S. Army Combat Surveillance  
and Target Acquisition Lab  
ATTN: SFAE-IEW-JS  
Fort Monmouth, NJ 07703-5305

Director  
Federal Aviation Administration  
FAA Technical Center  
Atlantic City, NJ 08405

Director  
Walter Reed Army Institute of Research  
Washington, DC 20307-5100

IAF Liaison Officer for Safety  
USAF Safety Agency/SEFF  
9750 Avenue G, SE  
Kirtland Air Force Base  
NM 87117-5671

Naval Aerospace Medical  
Institute Library  
Building 1953, Code 03L  
Pensacola, FL 32508-5600

Command Surgeon  
HQ USCENTCOM (CCSG)  
U.S. Central Command  
MacDill Air Force Base, FL 33608

Director  
Directorate of Combat Developments  
ATTN: ATZQ-CD  
Building 515  
Fort Rucker, AL 36362

U.S. Air Force Institute  
of Technology (AFIT/LDEE)  
Building 640, Area B  
Wright-Patterson  
Air Force Base, OH 45433

Henry L. Taylor  
Director, Institute of Aviation  
University of Illinois-Willard Airport  
Savoy, IL 61874

Chief, National Guard Bureau  
ATTN: NGB-ARS  
Arlington Hall Station  
111 South George Mason Drive  
Arlington, VA 22204-1382

AAMRL/HEX  
Wright-Patterson  
Air Force Base, OH 45433

Commander  
U.S. Army Aviation and Troop Command  
ATTN: AMSAT-R-ES  
4300 Goodfellow Boulevard  
St. Louis, MO 63120-1798

U.S. Army Aviation and Troop Command  
Library and Information Center Branch  
ATTN: AMSAV-DIL  
4300 Goodfellow Boulevard  
St. Louis, MO 63120

Federal Aviation Administration  
Civil Aeromedical Institute  
Library AAM-400A  
P.O. Box 25082  
Oklahoma City, OK 73125

Commander  
U.S. Army Medical Department  
and School  
ATTN: Library  
Fort Sam Houston, TX 78234

Commander  
U.S. Army Institute of Surgical Research  
ATTN: SGRD-USM  
Fort Sam Houston, TX 78234-6200

Air University Library  
(AUL/LSE)  
Maxwell Air Force Base, AL 36112

Product Manager  
Aviation Life Support Equipment  
ATTN: SFAE-AV-LSE  
4300 Goodfellow Boulevard  
St. Louis, MO 63120-1798



Commander and Director  
USAE Waterways Experiment Station  
ATTN: CEWES-IM-MI-R,  
CD Department  
3909 Halls Ferry Road  
Vicksburg, MS 39180-6199

Commanding Officer  
Naval Biodynamics Laboratory  
P.O. Box 24907  
New Orleans, LA 70189-0407

Assistant Commandant  
U.S. Army Field Artillery School  
ATTN: Morris Swott Technical Library  
Fort Sill, OK 73503-0312

Mr. Peter Seib  
Human Engineering Crew Station  
Box 266  
Westland Helicopters Limited  
Yeovil, Somerset BA20 2YB UK

U.S. Army Dugway Proving Ground  
Technical Library, Building 5330  
Dugway, UT 84022

U.S. Army Yuma Proving Ground  
Technical Library  
Yuma, AZ 85364

AFFTC Technical Library  
6510 TW/TSTL  
Edwards Air Force Base,  
CA 93523-5000

Commander  
Code 3431  
Naval Weapons Center  
China Lake, CA 93555

Aeromechanics Laboratory  
U.S. Army Research and Technical Labs  
Ames Research Center, M/S 215-1  
Moffett Field, CA 94035

Sixth U.S. Army  
ATTN: SMA  
Presidio of San Francisco, CA 94129

Commander  
U.S. Army Aeromedical Center  
Fort Rucker, AL 36362

Strughold Aeromedical Library  
Document Service Section  
2511 Kennedy Circle  
Brooks Air Force Base, TX 78235-5122

Dr. Diane Damos  
Department of Human Factors  
ISSM, USC  
Los Angeles, CA 90089-0021

U.S. Army White Sands  
Missile Range  
ATTN: STEWS-IM-ST  
White Sands Missile Range, NM 88002

Director, Airworthiness Qualification Test  
Directorate (ATTC)  
ATTN: STEAT-AQ-O-TR (Tech Lib)  
75 North Flightline Road  
Edwards Air Force Base, CA 93523-6100

Ms. Sandra G. Hart  
Ames Research Center  
MS 262-3  
Moffett Field, CA 94035

Commander  
USAMRMC  
ATTN: SGRD-UMZ  
Fort Detrick, Frederick, MD 21702-5009

Commander  
U.S. Army Health Services Command  
ATTN: HSOP-SO  
Fort Sam Houston, TX 78234-6000

U. S. Army Research Institute  
Aviation R&D Activity  
ATTN: PERI-IR  
Fort Rucker, AL 36362

Commander  
U.S. Army Safety Center  
Fort Rucker, AL 36362

U.S. Army Aircraft Development  
Test Activity  
ATTN: STEBG-MP-P  
Cairns Army Air Field  
Fort Rucker, AL 36362

Commander  
USAMRMC  
ATTN: SGRD-PLC (COL R. Gifford)  
Fort Detrick, Frederick, MD 21702

TRADOC Aviation LO  
Unit 21551, Box A-209-A  
APO AE 09777

Netherlands Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

British Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

Italian Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

Directorate of Training Development  
Building 502  
Fort Rucker, AL 36362

Chief  
USAHEL/USAAVNC Field Office  
P. O. Box 716  
Fort Rucker, AL 36362-5349

Commander, U.S. Army Aviation Center  
and Fort Rucker  
ATTN: ATZQ-CG  
Fort Rucker, AL 36362

Chief  
Test & Evaluation Coordinating Board  
Cairns Army Air Field  
Fort Rucker, AL 36362

Canadian Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

German Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

French Army Liaison Office  
USAAVNC (Building 602)  
Fort Rucker, AL 36362-5021

Australian Army Liaison Office  
Building 602  
Fort Rucker, AL 36362

Dr. Garrison Rapmund  
6 Burning Tree Court  
Bethesda, MD 20817

Commandant, Royal Air Force  
Institute of Aviation Medicine  
Farnborough, Hampshire GU14 6SZ UK

Defense Technical Information  
Cameron Station, Building 5  
Alexandra, VA 22304-6145

Commander, U.S. Army Foreign Science  
and Technology Center  
AIFRTA (Davis)  
220 7th Street, NE  
Charlottesville, VA 22901-5396

Commander  
Applied Technology Laboratory  
USARTL-ATCOM  
ATTN: Library, Building 401  
Fort Eustis, VA 23604

Commander, U.S. Air Force  
Development Test Center  
101 West D Avenue, Suite 117  
Eglin Air Force Base, FL 32542-5495

Aviation Medicine Clinic  
TMC #22, SAAF  
Fort Bragg, NC 28305

Dr. H. Dix Christensen  
Bio-Medical Science Building, Room 753  
Post Office Box 26901  
Oklahoma City, OK 73190

Commander, U.S. Army Missile  
Command  
Redstone Scientific Information Center  
ATTN: AMSMI-RD-CS-R  
/ILL Documents  
Redstone Arsenal, AL 35898

Aerospace Medicine Team  
HQ ACC/SGST3  
162 Dodd Boulevard, Suite 100  
Langley Air Force Base,  
VA 23665-1995

U.S. Army Research and Technology  
Laboratories (AVSCOM)  
Propulsion Laboratory MS 302-2  
NASA Lewis Research Center  
Cleveland, OH 44135

Commander  
USAMRMC  
ATTN: SGRD-ZC (COL John F. Glenn)  
Fort Detrick, Frederick, MD 21702-5012

Dr. Eugene S. Channing  
166 Baughman's Lane  
Frederick, MD 21702-4083

U.S. Army Medical Department  
and School  
USAMRDALC Liaison  
ATTN: HSMC-FR  
Fort Sam Houston, TX 78234

NVESD  
AMSEL-RD-NV-ASID-PST  
(Attn: Trang Bui)  
10221 Burbeck Road  
Fort Belvoir, VA 22060-5806

CA Av Med  
HQ DAAC  
Middle Wallop  
Stockbridge, Hants S020 8DY UK

Dr. Christine Schlichting  
Behavioral Sciences Department  
Box 900, NAVUBASE NLON  
Groton, CT 06349-5900

Commander  
Aviation Applied Technology Directorate  
ATTN: AMSAT-R-TV  
Fort Eustis, VA 23604-5577

COL Yehezkel G. Caine, MD  
Surgeon General, Israel Air Force  
Aeromedical Center Library  
P. O. Box 02166 I.D.F.  
Israel

HQ ACC/DOHP  
205 Dodd Boulevard, Suite 101  
Langley Air Force Base,  
VA 23665-2789

41st Rescue Squadron  
41st RQS/SG  
940 Range Road  
Patrick Air Force Base,  
FL 32925-5001

48th Rescue Squadron  
48th RQS/SG  
801 Dezonias Road  
Holloman Air Force Base,  
NM 88330-7715

HQ, AFOMA  
ATTN: SGPA (Aerospace Medicine)  
Bolling Air Force Base,  
Washington, DC 20332-6128

ARNG Readiness Center  
ATTN: NGB-AVN-OP  
Arlington Hall Station  
111 South George Mason Drive  
Arlington, VA 22204-1382

35th Fighter Wing  
35th FW/SG  
PSC 1013  
APO AE 09725-2055

66th Rescue Squadron  
66th RQS/SG  
4345 Tyndall Avenue  
Nellis Air Force Base, NV 89191-6076

71st Rescue Squadron  
71st RQS/SG  
1139 Redstone Road  
Patrick Air Force Base,  
FL 32925-5000

Director  
Aviation Research, Development  
and Engineering Center  
ATTN: AMSAT-R-Z  
4300 Goodfellow Boulevard  
St. Louis, MO 63120-1798

Commander  
USAMRMC  
ATTN: SGRD-ZB (COL C. Fred Tyner)  
Fort Detrick, Frederick, MD 21702-5012

Commandant  
U.S. Army Command and General Staff  
College  
ATTN: ATZL-SWS-L  
Fort Leavenworth, KS 66027-6900

ARNG Readiness Center  
ATTN: NGB-AVN-OP  
Arlington Hall Station  
111 South George Mason Drive  
Arlington, VA 22204-1382

Director  
Army Personnel Research Establishment  
Farnborough, Hants GU14 6SZ UK

Dr. A. Kornfield  
895 Head Street  
San Francisco, CA 94132-2813

ARNG Readiness Center  
ATTN: NGB-AVN-OP  
Arlington Hall Station  
111 South George Mason Drive  
Arlington, VA 22204-1382

Commander, U.S. Army Test  
and Evaluation Command  
Directorate for Test and Evaluation  
ATTN: AMSTE-TA-M (Human Factors  
Group)  
Aberdeen Proving Ground,  
MD 21005-5055

Naval Air Systems Command  
Technical Air Library 950D  
Room 278, Jefferson Plaza II  
Department of the Navy  
Washington, DC 20361

Director  
U.S. Army Ballistic  
Research Laboratory  
ATTN: DRXBR-OD-ST Tech Reports  
Aberdeen Proving Ground, MD 21005

Commander  
U.S. Army Medical Research  
Institute of Chemical Defense  
ATTN: SGRD-UV-AO  
Aberdeen Proving Ground,  
MD 21010-5425

Commander  
USAMRMC  
ATTN: SGRD-RMS  
Fort Detrick, Frederick, MD 21702-5012

HQ DA (DASG-PSP-O)  
5109 Leesburg Pike  
Falls Church, VA 22041-3258

Harry Diamond Laboratories  
ATTN: Technical Information Branch  
2800 Powder Mill Road  
Adelphi, MD 20783-1197

U.S. Army Materiel Systems  
Analysis Agency  
ATTN: AMXSY-PA (Reports Processing)  
Aberdeen Proving Ground  
MD 21005-5071

U.S. Army Ordnance Center  
and School Library  
Simpson Hall, Building 3071  
Aberdeen Proving Ground, MD 21005

U.S. Army Environmental  
Hygiene Agency  
ATTN: HSHB-MO-A  
Aberdeen Proving Ground, MD 21010

Technical Library Chemical Research  
and Development Center  
Aberdeen Proving Ground, MD  
21010-5423

Commander  
U.S. Army Medical Research  
Institute of Infectious Disease  
ATTN: SGRD-UIZ-C  
Fort Detrick, Frederick, MD 21702

Director, Biological  
Sciences Division  
Office of Naval Research  
600 North Quincy Street  
Arlington, VA 22217

Commandant  
U.S. Army Aviation  
Logistics School ATTN: ATSQ-TDN  
Fort Eustis, VA 23604

Headquarters (ATMD)  
U.S. Army Training  
and Doctrine Command  
ATTN: ATBO-M  
Fort Monroe, VA 23651

Cdr, PERSCOM  
ATTN: TAPC-PLA  
200 Stovall Street, Rm 3N25  
Alexandria, VA 22332-0413

HQ, AFOMA  
ATTN: SGPA (Aerospace Medicine)  
Bolling Air Force Base,  
Washington, DC 20332-6188